## **Compliance Operations Branch - Significant Camera Site Events Report**

Date Range: 1/01/2014 - 30/06/2016

Categories: Vehicle Detection



| Event      | Site   | Codecode                 | Lacation                                 | Discotion          | Cult Cata many                   | Restoration                    | Delegation      | Date       | Site     |
|------------|--------|--------------------------|--|--------------------|----------------------------------|--------------------------------|-----------------|------------|----------|
| Date       | No.    | Suburb                   | Location                                 | Direction          | Sub Category                     | Comments                       | ID              | Rectified  | Down     |
| FDSC Cam   | neras  |                          |  |                    |                                  |                                |                 |            |          |
| 1/06/2016  | 9620   | New Italy                | Pacific Highway, New Italy               | North &            | Not detecting all heavy vehicles |                                | 3399            |            | <b>✓</b> |
|            |        |                          |  | South              |                                  |                                | 3553            |            |          |
| Details:   | Road s | urface instability - Hea | avy Vehicles only. Sight audit conducted | d, any/all inciden | ts affected culled/withdrawn.    |                                |                 |            |          |
|            |        |                          |  |                    |                                  |                                |                 | Site Ev    | vents: 1 |
| 13/02/2015 | 9813   | Maroubra (B) (Z)         | Malabar Road, Maroubra B                 | North              | Vehicle position review          | SDCM replaced, site certified. | 3344            | 16/02/2015 |          |
| Details:   | Speed  | Measurement Device I     | Malfunction. Sight audit conducted, any  | /all incidents aff | ected culled/withdrawn.          |                                |                 |            |          |
|            |        |                          |  |                    |                                  |                                |                 | Site Ev    | /ents: 1 |
|            |        |                          |  |                    |                                  |                                | T-(-) FD00 M-:- |            |          |

**Total FDSC Maintenance Events: 2** 

**RLSC Cameras** 

Details:

13/02/2015 7254 North Ryde (Z) Lane Cove Road (Southbound) at the intersection with Cox's Road, North Ryde (Z)

South

Test results to be reviewed by OS&D (Technical)

System operations verified. Site certified.

3347 3348

11/03/2015

Adjacent lane interference. Site audit conducted, any/all incidents affected culled/withdrawn.

Site Events: 1

**Total RLSC Maintenance Events: 1** 

**Grand Total Maintenance Events: 3** 

## **Compliance Operations Branch - Camera Issue Maintenance Events Report**

Date Range: 1/01/2014 - 30/06/2016

Categories: Camera, Flash, Image Creation, Image Quality



| Event<br>Date | Site<br>No. | Suburb          | Location                      | Direction     | Sub Category                          | Restoration<br>Comments                          | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-----------------|-------------------------------|---------------|---------------------------------------|--|-------------------|--------------|
| FDSC Cam      | neras       |                 |                               |               |                                       |  |                   |              |
| 27/04/2015    | 9522        | Burwood Heights | Hume Highway, Burwood Heights | West          | Camera requires realignment           | Camera realigned, tested OK.                     | 28/04/2015        |              |
|               |             |                 |                               |               |                                       |  | Site Ev           | ents: 1      |
| 20/08/2015    | 9530        | Clunes          | Bangalow Road, Clunes         | North & South | Images dark - night                   | Flash lens cleaned.                              | 24/08/2015        |              |
|               |             |                 |                               |               |                                       |  | Site Ev           | ents: 1      |
| 26/04/2016    | 9534        | Auburn          | Parramatta Road, Auburn       | East          | Images dark - night                   | Flash circuit breaker reset, tested OK.          | 28/04/2016        |              |
|               |             |                 |                               |               |                                       |  | Site Ev           | ents: 1      |
| 11/03/2015    | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Images dark - night                   | Flash replaced.                                  | 17/03/2015        |              |
| 11/05/2015    | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Unable to connect to auxiliary camera | Camera replaced.                                 | 18/05/2015        |              |
|               |             |                 |                               |               |                                       | Site certified.                                  |                   |              |
| 18/09/2015    | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Unable to connect to auxiliary camera | Camera power cycled, tested OK.                  | 23/09/2015        | <b>✓</b>     |
| 1/10/2015     | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Unable to connect to auxiliary camera | Camera replaced.                                 | 14/10/2015        | <b>✓</b>     |
|               |             |                 |                               |               |                                       | Site certified.                                  |                   |              |
| 5/01/2016     | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Unable to connect to auxiliary camera | Connection tested OK.                            | 5/01/2016         | <b>✓</b>     |
| 23/02/2016    | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Images out of focus                   | Focus adjusted, tested OK.                       | 24/02/2016        |              |
| 21/03/2016    | 9535        | Ourimbah        | M1 Pacific Motorway, Ourimbah | North         | Camera requires realignment           | Camera settings adjusted, tested OK.             | 22/03/2016        |              |
|               |             |                 |                               |               |                                       |  | Site Eve          | ents: 7      |
| 8/05/2015     | 9540        | Camellia        | James Ruse Drive, Camellia    | South         | Flash not discharging                 | Flash enabled, tested OK.                        | 15/05/2015        |              |
| 7/09/2015     | 9540        | Camellia        | James Ruse Drive, Camellia    | South         | Images dark - night                   | Flash circuit breaker reset, tested OK.          | 11/09/2015        |              |
| 4/04/2016     | 9540        | Camellia        | James Ruse Drive, Camellia    | South         | Images out of focus                   | Image quality verified, no further action taken. | 27/04/2016        |              |
|               |             |                 |                               |               |                                       |  | Site Ev           | ents: 3      |

| Event<br>Date | Site<br>No. | Suburb           | Location                                | Direction     | Sub Category                   | Restoration<br>Comments                  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|------------------|---|---------------|--------------------------------|--|-------------------|--------------|
| 13/04/2015    | 9541        | North Parramatta | Pennant Hills Road, North<br>Parramatta | East          | Flash not discharging          | Flash replaced, tested OK.               | 15/04/2015        |              |
| 4/11/2015     | 9541        | North Parramatta | Pennant Hills Road, North               | East          | Unable to connect to camera    | Hard drive (HDD) reimaged.               | 11/11/2015        |              |
|               |             |                  | Parramatta                              |               |                                | Site certified.                          |                   |              |
|               |             |                  |   |               |                                |  | Site Ev           | vents: 2     |
| 17/09/2015    | 9543        | Greystanes       | Greystanes Road, Greystanes             | North         | Unable to connect to camera    | Camera power cycled, tested OK.          | 18/09/2015        | <b>✓</b>     |
| 22/10/2015    | 9543        | Greystanes       | Greystanes Road, Greystanes             | North         | Unable to connect to camera    | Camera replaced, site certified.         | 10/11/2015        | <b>✓</b>     |
| 20/11/2015    | 9543        | Greystanes       | Greystanes Road, Greystanes             | North         | Images dark - night            | Flash replaced.                          | 24/11/2015        |              |
| 17/03/2016    | 9543        | Greystanes       | Greystanes Road, Greystanes             | North         | Not generating incidents       | System operations verified.              | 22/03/2016        | <b>✓</b>     |
|               |             |                  |   |               |                                |  | Site Ev           | vents: 4     |
| 5/05/2015     | 9546        | Lansvale         | Hume Highway, Lansvale                  | South         | Camera requires realignment    | Camera realigned, tested OK.             | 19/05/2015        |              |
| 2/10/2015     | 9546        | Lansvale         | Hume Highway, Lansvale                  | South         | Not generating incidents       | Break-out box replaced.                  | 7/10/2015         |              |
| 4/02/2016     | 9546        | Lansvale         | Hume Highway, Lansvale                  | South         | Not generating incidents       | System operations verified.              | 10/02/2016        |              |
| 4/02/2016     | 9546        | Lansvale         | Hume Highway, Lansvale                  | South         | Flash not discharging          | Flash replaced.                          | 9/02/2016         |              |
|               |             |                  |   |               |                                |  | Site Ev           | ents: 4      |
| 16/06/2015    | 9547        | South Windsor    | George Street, South Windsor            | North & South | Camera requires realignment    | Camera realigned, tested OK.             | 18/06/2015        |              |
|               |             |                  |   |               |                                |  | Site Ev           | ents: 1      |
| 5/11/2015     | 9548        | Valley Heights   | Great Western Highway, Valley           | East          | Distorted images               | Camera replaced.                         | 13/11/2015        |              |
|               |             |                  | Heights                                 |               |                                | Site certifiied.                         |                   |              |
|               |             |                  |   |               |                                |  | Site Ev           | ents: 1      |
| 16/04/2015    | 9550        | Lane Cove        | Centennial Avenue, Lane Cove            | South         | Unable to connect to camera    | Camera power supply replaced, tested OK. | 24/04/2015        | <b>✓</b>     |
|               |             |                  |   |               |                                | Site certified.                          |                   |              |
| 27/06/2016    | 9550        | Lane Cove        | Centennial Avenue, Lane Cove            | South         | Distorted images               | Camera drivers reinstalled, tested OK.   | 28/06/2016        |              |
|               |             |                  |   |               |                                |  | Site Ev           | ents: 2      |
| 13/07/2015    | 9551        | Bardwell Park    | M5 Motorway, Bardwell Park              | East          | Horizontal bands across images | Camera system restarted, tested OK.      | 13/07/2015        |              |
| 28/01/2016    | 9551        | Bardwell Park    | M5 Motorway, Bardwell Park              | East          | Flash not discharging          | Flash enabled, tested OK.                | 9/02/2016         |              |
|               |             |                  |   |               |                                |  | Site Ev           | ents: 2      |

| Date<br>Rectified | Restoration<br>Comments   | Sub Category   | Direction  | Location   | Suburb  | Site<br>No.  | Event<br>Date   |
|-------------------|---|--|--|--|---|--|---|
| 21/01/2016        | Cable replaced, tested OK.  | Unable to connect to camera  | West   | M5 Motorway, Arncliffe   | Arncliffe   | 9552   | 5/01/2016   |
| Site Ever         |   |  |  |  |   |  |   |
| 12/03/2015        | Camera settings adjusted, tested OK.  | Images dark - night  | East   | Blaxland Road, Ryde  | Ryde  | 9554   | 11/03/2015  |
| 18/06/2015        | MPU replaced.   | Unable to connect to camera  | East   | Blaxland Road, Ryde  | Ryde  | 9554   | 11/06/2015  |
|                   | Site certified.   |  |  |  |   |  |   |
| Site Ever         |   |  |  |  |   |  |   |
| 3/05/2016         | Camera wafer board replaced.  | Unable to connect to camera  | North  | Memorial Drive, Corrimal   | Corrimal  | 9556   | 19/04/2016  |
|                   | Site certified.   |  |  |  |   |  |   |
| Site Ever         |   |  |  |  |   |  |   |
| 8/12/2015         | Hard drive (HDD) replaced.  | Hard drive disk space (HDD) low  | South  | Memorial Drive, Corrimal   | Corrimal  | 9557   | 2/12/2015   |
|                   | Site certified.   |  |  |  |   |  |   |
| 1/06/2016         | Camera settings adjusted, tested OK.  | Hard drive disk space (HDD) low  | South  | Memorial Drive, Corrimal   | Corrimal  | 9557   | 31/05/2016  |
| Site Ever         |   |  |  |  |   |  |   |
| 23/03/2015        | Camera replaced, site certified.  | Unable to connect to camera  | North & South  | Pacific Highway, Valla   | Valla   | 9567   | 17/03/2015  |
| Site Ever         |   |  |  |  |   |  |   |
| 31/03/2016        | Flash replaced.   | Images dark - night  | East & West  | New England Highway, Tenterfield   | Tenterfield   | 9568   | 29/03/2016  |
| Site Ever         |   |  |  |  |   |  |   |
| 22/08/2015        | Flash realigned, tested OK.   | Flash requires realignment   | South  | Pacific Highway, Wardell   | Wardell   | 9570   | 10/08/2015  |
| 10/11/2015        | Camera housing lens cleaned.  | Images out of focus  | South  | Pacific Highway, Wardell   | Wardell   | 9570   | 9/11/2015   |
| Site Ever         |   |  |  |  |   |  |   |
| 11/09/2015        | Camera system restarted, tested OK.   | Images dark - day  | East & West  | Bruxner Highway, Wollongbar  | Wollongbar  | 9571   | 25/08/2015  |
|                   |   |  |  |  |   |  |   |
| r                 | Rectified 21/01/2016 Site Eve 12/03/2015  18/06/2015  Site Eve 3/05/2016  Site Eve 8/12/2015  1/06/2016  Site Eve 23/03/2015 Site Eve 21/03/2016 Site Eve 22/08/2015  10/11/2015 Site Eve | Comments Cable replaced, tested OK.  Camera settings adjusted, tested OK.  MPU replaced. Site Eve Camera wafer board replaced. Site certified.  Site Eve Camera wafer board replaced. Site certified.  Site Eve Hard drive (HDD) replaced. Site certified.  Camera settings adjusted, tested OK.  Site Eve Flash replaced. Site certified.  Site Eve Camera replaced, site certified.  Site Eve Flash realigned, tested OK.  Camera housing lens cleaned.  Site Eve Camera system restarted, tested 1/09/2015 Site Eve Camera system restarted, tested 1/09/2015 | Sub Category Unable to connect to camera Cable replaced, tested OK. 21/01/2016  Site Eve Images dark - night Camera settings adjusted, tested OK. Unable to connect to camera MPU replaced. Site certified. Site Eve Unable to connect to camera Camera wafer board replaced. Site certified. Site Eve Hard drive disk space (HDD) low Hard drive (HDD) replaced. Site certified. Hard drive disk space (HDD) low Camera settings adjusted, tested OK. Site Eve Unable to connect to camera Camera replaced. Site certified. Site Eve Unable to connect to camera Flash replaced, site certified. Site Eve Unable to connect to camera Camera settings adjusted, tested OK. Site Eve Unable to connect to camera Camera replaced, site certified. Site Eve Images dark - night Flash replaced. Site Eve Flash requires realignment Flash realigned, tested OK. 22/08/2015 Images out of focus Camera system restarted, tested 11/09/2015 | Direction         Sub Category         Comments         Rectified           West         Unable to connect to camera         Cable replaced, tested OK.         21/01/2016           East         Images dark - night         Camera settings adjusted, tested OK.         12/03/2015           East         Unable to connect to camera         MPU replaced. Site certified.         3/05/2016           North         Unable to connect to camera         Camera wafer board replaced. Site certified.         3/05/2016           South         Hard drive disk space (HDD) low         Hard drive (HDD) replaced. Site certified.         8/12/2015           South         Hard drive disk space (HDD) low         Camera settings adjusted, tested OK.         1/06/2016           South         Hard drive disk space (HDD) low         Camera replaced, site certified.         23/03/2015           North & South         Unable to connect to camera         Camera replaced, site certified.         23/03/2015           East & West         Images dark - night         Flash replaced.         31/03/2016           Flash repaires realignment         Flash realigned, tested OK.         22/08/2015           South         Images out of focus         Camera housing lens cleaned.         10/11/2015           East & West         Images dark - day         Camera system restarted, tested | Location Direction Sub Category Comments Rectified  M5 Motorway, Arncliffe West Unable to connect to camera Cable replaced, tested OK. 21/01/2016  Site Eve  Blaxland Road, Ryde East Images dark - night Camera estitings adjusted, tested OK. 12/03/2015  Blaxland Road, Ryde East Unable to connect to camera MPU replaced. Site certified.  Site Eve  Memorial Drive, Corrimal North Unable to connect to camera Camera wafer board replaced. Site certified.  Site Eve  Memorial Drive, Corrimal South Hard drive disk space (HDD) low Hard drive (HDD) replaced. B/12/2015  Site certified.  Memorial Drive, Corrimal South Hard drive disk space (HDD) low Camera settings adjusted, tested OK. Site Eve  Pacific Highway, Valla North & South Unable to connect to camera Camera replaced, site certified. 23/03/2016  Site Eve  Pacific Highway, Tenterfield East & West Images dark - night Flash replaced. Site replaced. 31/03/2016  Site Eve  Pacific Highway, Wardell South Flash requires realignment Flash realigned, tested OK. 22/08/2015  Pacific Highway, Wardell South Images out of focus Camera housing lens cleaned. 10/11/2015  Site Eve  Bruxner Highway, Worlongbar East & West Images dark - day Camera system restarted, tested 11/09/2015 | Subtro Ancliffe Blaxland Road, Ryde Blaxland Road, Ryde East Unable to connect to camera Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Blaxland Road, Ryde Blaxland Road, Ryde East Unable to connect to camera Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Blaxland Road, Ryde East Unable to connect to camera Ancliffe Blaxland Road, Ryde East Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Ancliffe Blaxland Road, Ryde East Ancliffe | No. Suburb Location Direction Sub Category Comments Rectified  475 Arrollfe M5 M6 torway, Arrollfe W5 Unable to connect to camera Cable replaced, tested OK. 21/01/2016 Site Ever  475 Arrollfe Ryde Blaxland Road, Ryde East Images dark - night Comment to camera Site certified. 21/03/2015 Site Ever  475 Arrollfe Ryde Blaxland Road, Ryde East Unable to connect to camera M6H1 replaced. Site certified. 31/06/2015 Site Ever  475 Corrinal Memorial Drive, Corrimal North Unable to connect to camera Camera wafer board replaced. 31/05/2016 Site certified. 31/06/2015 |

| e<br>Suburb         |  |  |  | Restoration   | Date   | Site   |
|---------------------|--|--|--|---|--|--|
| Suburb              | Location   | Direction  | Sub Category   | Comments  | Rectified  | Down   |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Flash not discharging  | Flash replaced.   | 7/05/2015  |  |
|                     |  |  |  | Flash cables reterminated, tested OK.   |  |  |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Images dark - night  | Camera settings adjusted, tested OK.  | 31/08/2015   |  |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Flash not discharging  | Flash cables reterminated, tested OK.   | 14/10/2015   |  |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Images dark - night  | Flash settings adjusted, tested OK.   | 24/11/2015   |  |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Images black   | Camera replaced.  | 19/01/2016   | <b>✓</b>   |
|                     |  |  |  | Site certified.   |  |  |
| 73 Peakhurst        | Henry Lawson Drive, Peakhurst  | West   | Flash not discharging  | Flash circuit breaker reset, tested OK.   | 15/02/2016   |  |
|                     |  |  |  |   | Site Ev  | ents: 6  |
| 74 Korora           | Pacific Highway, Korora  | North  | Images dark - night  | Flash settings adjusted, tested OK.   | 23/10/2015   |  |
|                     |  |  |  |   | Site Ev  | ents: 1  |
| 78 North Macksville | Pacific Highway, North Macksville  | North & South  | Images dark - night  | Flash replaced.   | 3/09/2015  |  |
|                     |  |  |  |   | Site Ev  | ents: 1  |
| 79 Blandford        | New England Highway, Blandford   | North & South  | Unable to connect to camera  | MPU replaced.   | 29/12/2015   | <b>✓</b>   |
|                     |  |  |  | Site certified.   |  |  |
| 79 Blandford        | New England Highway, Blandford   | North & South  | Unable to enable/ disable camera operations  | Power cable reseated, tested OK.  | 9/06/2016  |  |
|                     |  |  |  |   | Site Ev  | ents: 2  |
| 31 Sandgate         | Pacific Highway, Sandgate  | South  | Unable to enable/ disable camera operations  | EC replaced, tested OK.   | 8/04/2016  |  |
| 31 Sandgate         | Pacific Highway, Sandgate  | South  | Unable to enable/ disable camera operations  | EC rebooted, tested OK.   | 27/04/2016   |  |
|                     |  |  |  |   | Site Ev  | ents: 2  |
| Nords Wharf         | Pacific Highway, Nords Wharf   | North  | Not generating incidents   | Main Processing Unit (MPU) replaced.  | 1/07/2015  | <b>✓</b>   |
|                     |  |  |  | Main Processing Unit (MPU) replaced. Site certified.  |  |  |
| 7 7 7 7 8 8         | 3 Peakhurst 3 Peakhurst 3 Peakhurst 3 Peakhurst 4 Korora  Korora  North Macksville 9 Blandford 9 Blandford 1 Sandgate 1 Sandgate | Peakhurst Henry Lawson Drive, Peakhurst  Henry Lawson Drive, Peakhurst  Peakhurst Henry Lawson Drive, Peakhurst  Rorora Pacific Highway, Korora  North Macksville Pacific Highway, North Macksville  Blandford New England Highway, Blandford  New England Highway, Blandford  Sandgate Pacific Highway, Sandgate  Sandgate Pacific Highway, Sandgate | Peakhurst Henry Lawson Drive, Peakhurst West  North Macksville Pacific Highway, Korora North  North Macksville Pacific Highway, North Macksville North & South  Peakhurst Henry Lawson Drive, Peakhurst West  North Macksville Pacific Highway, Korora North  North & South  Peakhurst West  North Macksville North & South  Pacific Highway, North Macksville North & South  Sandgate Pacific Highway, Sandgate South  Sandgate Pacific Highway, Sandgate South | Peakhurst Henry Lawson Drive, Peakhurst West Images dark - night  Henry Lawson Drive, Peakhurst West Flash not discharging  Peakhurst Henry Lawson Drive, Peakhurst West Images dark - night  Peakhurst Henry Lawson Drive, Peakhurst West Images black  Peakhurst Henry Lawson Drive, Peakhurst West Images black  Peakhurst Henry Lawson Drive, Peakhurst West Flash not discharging  Korora Pacific Highway, Korora North Images dark - night  North Macksville Pacific Highway, North Macksville North & South Images dark - night  North Macksville Pacific Highway, Blandford North & South Unable to connect to camera  Pacific Highway, Blandford North & South Unable to enable/ disable camera operations  Sandgate Pacific Highway, Sandgate South Unable to enable/ disable camera operations | Flash cables reterminated, tested OK.  3 Peakhurst Henry Lawson Drive, Peakhurst West Images dark - night Camera settings adjusted, tested OK.  3 Peakhurst Henry Lawson Drive, Peakhurst West Flash not discharging Flash settings adjusted, tested OK.  3 Peakhurst Henry Lawson Drive, Peakhurst West Images dark - night Flash settings adjusted, tested OK.  4 Henry Lawson Drive, Peakhurst West Images black Camera replaced.  5 Site certified.  5 Peakhurst Henry Lawson Drive, Peakhurst West Flash not discharging Flash circuit breaker reset, tested OK.  6 West Flash not discharging Flash forcivit breaker reset, tested OK.  7 Peakhurst Henry Lawson Drive, Peakhurst West Flash not discharging Flash circuit breaker reset, tested OK.  8 Norora Pacific Highway, Korora North Images dark - night Flash settings adjusted, tested OK.  9 Blandford Pacific Highway, North Macksville North & South Unable to connect to camera MPU replaced.  9 Blandford New England Highway, Blandford North & South Unable to enable/ disable camera operations Power cable reseated, tested OK.  1 Sandgate Pacific Highway, Sandgate South Unable to enable/ disable camera operations EC replaced, tested OK.  8 Nords Wharf Pacific Highway, Nords Wharf North North Not generating incidents Main Processing Unit (MPU) replaced.  8 Main Processing Unit (MPU) replaced.  8 Main Processing Unit (MPU) replaced. | Peakhurst   Henry Lawson Drive, Peakhurst   West   Images dark - night   Gamera settings adjusted, tested OK   31/08/2015   OK   OK   OK   OK   OK   OK   OK   O |

| Event<br>Date | Site<br>No. | Suburb      | Location   | Direction     | Sub Category                                | Restoration<br>Comments                             | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------|--|---------------|---|---|-------------------|--------------|
| 7/07/2015     | 9586        | Rankin Park | McCaffrey Drive, Rankin Park                     | East & West   | Images dark - night                         | Camera settings adjusted, tested OK.                | 10/07/2015        |              |
| 14/08/2015    | 9586        | Rankin Park | McCaffrey Drive, Rankin Park                     | East & West   | Zoom adjustment required                    | Zoom adjusted, tested OK.                           | 11/09/2015        |              |
| 18/08/2015    | 9586        | Rankin Park | McCaffrey Drive, Rankin Park                     | East & West   | Images dark - night                         | Camera settings adjusted, tested OK.                | 11/09/2015        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 3     |
| 5/05/2016     | 9592        | Warrawong   | Northcliffe Drive, Warrawong                     | East          | Flash not discharging                       | Flash circuit breaker reset, tested OK.             | 12/05/2016        |              |
| 5/05/2016     | 9592        | Warrawong   | Northcliffe Drive, Warrawong                     | East          | Unable to enable/ disable camera operations | Power cable reseated, tested OK.                    | 12/05/2016        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 2     |
| 12/10/2015    | 9594        | Bomaderry   | Bolong Road, Bomaderry                           | East          | Images dark - night                         | Flash circuit breaker reset, tested OK.             | 13/10/2015        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 1     |
| 21/05/2015    | 9597        | Gwynneville | M1 Princes Motorway                              | North         | Unable to connect to camera                 | Camera enabled.                                     | 28/05/2015        | <b>✓</b>     |
|               |             |             | (Northbound), Gwynneville                        |               |   | Camera enabled.                                     |                   |              |
|               |             |             |  |               |   | Site certified.                                     |                   |              |
| 1/06/2015     | 9597        | Gwynneville | M1 Princes Motorway<br>(Northbound), Gwynneville | North         | Unable to connect to camera                 | Cable replaced, tested OK.                          | 5/06/2015         | •            |
| 4/04/2016     | 9597        | Gwynneville | M1 Princes Motorway<br>(Northbound), Gwynneville | North         | Images dark - night                         | Camera system restarted, tested OK.                 | 27/04/2016        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 3     |
| 9/11/2015     | 9600        | Kogarah(Z)  | Princes Highway, Kogarah                         | North         | Images dark - night                         | Flash replaced.                                     | 2/12/2015         |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 1     |
| 2/03/2015     | 9602        | Mosman(Z)   | Macpherson Street, Mosman(Z)                     | North & South | Distorted images                            | Camera replaced, site certified.<br>Site certified. | 16/03/2015        | <b>✓</b>     |
| 16/06/2015    | 9602        | Mosman(Z)   | Macpherson Street, Mosman(Z)                     | North & South | Images over exposed                         | Camera settings adjusted, tested OK.                | 17/06/2015        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 2     |
| 22/06/2015    | 9603        | Gymea(Z)    | President Avenue, Gymea(Z)                       | East & West   | Images dark - night                         | Camera replaced. Site certified.                    | 25/06/2015        |              |
|               |             |             |  |               |   |   | Site Ev           | vents: 1     |

| Event<br>Date | Site<br>No. | Suburb             | Location                               | Direction     | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------------|--|---------------|--|--|-------------------|--------------|
| 2/04/2015     | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Distorted images   | Camera system restarted, tested OK.  | 7/04/2015         | <b>✓</b>     |
| 11/11/2015    | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Images out of focus  | Camera settings adjusted, tested OK.   | 20/11/2015        |              |
| 12/01/2016    | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Images out of focus  | Camera settings adjusted, tested OK.   | 13/01/2016        |              |
| 2/02/2016     | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Images out of focus  | Camera replaced.   | 5/02/2016         |              |
|               |             |                    |  |               |  | Site certified.  |                   |              |
| 19/05/2016    | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Unable to connect to camera  | Camera power supply replaced, tested OK.                                       | 23/05/2016        | <b>✓</b>     |
| 1/06/2016     | 9604        | Epping(Z)          | Carlingford Road, Epping(Z)            | East & West   | Distorted images   | Camera replaced.   | 6/06/2016         |              |
|               |             |                    |  |               |  | Site certifiied.   |                   |              |
|               |             |                    |  |               |  |  | Site Ev           | vents: 6     |
| 13/04/2015    | 9610        | West Wollongong(Z) | Princes Highway, West<br>Wollongong(Z) | North & South | Camera operations inconsistent for enabling/<br>disabling SZ scheduled times | Gazetted school dates/times modified.  | 14/04/2015        |              |
| 13/07/2015    | 9610        | West Wollongong(Z) | Princes Highway, West<br>Wollongong(Z) | North & South | Images out of focus  | Focus adjusted, tested OK.   | 15/07/2015        |              |
| 25/09/2015    | 9610        | West Wollongong(Z) |  | North & South | Images out of focus  | Camera replaced.   | 1/10/2015         |              |
|               |             |                    | Wollongong(Z)                          |               |  | Site certified.  |                   |              |
| 18/02/2016    | 9610        | West Wollongong(Z) |  | North & South | Unable to connect to camera  | Camera replaced.   | 3/03/2016         | <b>✓</b>     |
|               |             |                    | Wollongong(Z)                          |               |  | Site certified.  |                   |              |
| 17/05/2016    | 9610        | West Wollongong(Z) | Princes Highway, West<br>Wollongong(Z) | North & South | Distorted images   | Site certifiied.   | 18/05/2016        |              |
|               |             |                    |  |               |  |  | Site Ev           | vents: 5     |
| 22/03/2016    | 9612        | Brogo              | Princes Highway, Brogo                 | North & South | Images out of focus  | Focus adjusted, tested OK.   | 29/03/2016        |              |
|               |             |                    |  |               |  |  | Site Ev           | ents: 1      |
| 21/03/2016    | 9614        | East Sydney        | Cross City Tunnel, East Sydney         | West          | Images dark - night  | Camera settings adjusted, tested OK.   | 21/03/2016        |              |
| 24/06/2016    | 9614        | East Sydney        | Cross City Tunnel, East Sydney         | West          | Camera operating at speed limit after speed reduction                        | Communications loss between main camera and VSLS camera, setting reconfigured. | 4/07/2016         |              |
|               |             |                    |  |               |  |  | Sita Ev           | ants: 2      |

| Event<br>Date | Site<br>No. | Suburb       | Location                       | Direction     | Sub Category                          | Restoration<br>Comments                     | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|--------------------------------|---------------|---------------------------------------|---|-------------------|--------------|
| 25/05/2015    | 9615        | Mosman       | Spit Road, Mosman              | South         | Unable to connect to camera           | Camera replaced.                            | 10/06/2015        | •            |
|               |             |              |                                |               |                                       | Hard drive (HDD) replaced.                  |                   |              |
|               |             |              |                                |               |                                       | Site certified.                             |                   |              |
| 10/06/2015    | 9615        | Mosman       | Spit Road, Mosman              | South         | Unable to connect to camera           | Hard drive (HDD) reimaged.                  | 12/06/2015        | <b>✓</b>     |
|               |             |              |                                |               |                                       | Site certified.                             |                   |              |
| 1/04/2016     | 9615        | Mosman       | Spit Road, Mosman              | South         | Unable to connect to auxiliary camera | Connection tested OK.                       | 15/04/2016        |              |
| 23/05/2016    | 9615        | Mosman       | Spit Road, Mosman              | South         | Unable to connect to camera           | Camera power cycled, tested OK.             | 26/05/2016        | <b>✓</b>     |
|               |             |              |                                |               |                                       |   | Site Ev           | vents: 4     |
| 21/08/2015    | 9616        | Bar Point    | M1 Pacific Motorway, Bar Point | North         | Images out of focus                   | Camera settings adjusted, tested OK.        | 28/08/2015        |              |
| 5/01/2016     | 9616        | Bar Point    | M1 Pacific Motorway, Bar Point | North         | Unable to connect to camera           | Camera replaced, site certified.            | 13/01/2016        | <b>✓</b>     |
| 26/05/2016    | 9616        | Bar Point    | M1 Pacific Motorway, Bar Point | North         | Images over exposed                   | Camera settings adjusted, tested OK.        | 30/05/2016        |              |
|               |             |              |                                |               |                                       |   | Site Ev           | vents: 3     |
| 11/03/2015    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images dark - night                   | Flash replaced.                             | 19/03/2015        |              |
| 9/04/2015     | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Unable to connect to camera           | Camera power supply replaced, tested OK.    | 14/04/2015        | <b>✓</b>     |
| 7/10/2015     | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images dark - night                   | Flash replaced.                             | 13/10/2015        |              |
| 12/01/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Not creating images                   | Camera settings adjusted, tested OK.        | 13/01/2016        |              |
| 10/02/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images dark - day                     | Camera settings adjusted, tested OK.        | 12/02/2016        |              |
| 24/02/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images over exposed                   | Site certified.                             | 25/02/2016        |              |
|               |             |              |                                |               |                                       | Camera replaced.                            |                   |              |
| 29/03/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images black                          | Camera replaced.                            | 1/04/2016         | <b>✓</b>     |
|               |             |              |                                |               |                                       | Site certified.                             |                   |              |
| 21/04/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images black                          | Camera interface board replaced, tested OK. | 3/05/2016         |              |
| 13/05/2016    | 9617        | Bexley North | Bexley Road, Bexley North      | East & West   | Images black                          | Power supply replaced, tested OK.           | 18/05/2016        |              |
|               |             |              |                                |               |                                       |   | Site Ev           | ents: 9      |
|               | 9620        | New Italy    | Pacific Highway, New Italy     | North & South | Image review required                 | Camera system settings                      | 20/05/2015        |              |
| 14/05/2015    | 7020        |              |                                |               |                                       | reconfigured, tested OK.                    |                   |              |

| Event<br>Date | Site<br>No. | Suburb       | Location                          | Direction     | Sub Category                                | Restoration<br>Comments                | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|-----------------------------------|---------------|---|--|-------------------|--------------|
| 3/09/2015     | 9622        | Charmhaven   | Pacific Highway, Charmhaven       | North & South | Unable to connect to camera                 | Hard drive (HDD) replaced.             | 14/09/2015        | <b>✓</b>     |
|               |             |              |                                   |               |   | Site certified.                        |                   |              |
| 8/03/2016     | 9622        | Charmhaven   | Pacific Highway, Charmhaven       | North & South | Unable to connect to camera                 | Hard drive (HDD) replaced.             | 22/03/2016        | <b>✓</b>     |
| 18/03/2016    | 9622        | Charmhaven   | Pacific Highway, Charmhaven       | North & South | Flash not discharging                       | Camera settings adjusted, tested OK.   | 22/03/2016        |              |
| 18/03/2016    | 9622        | Charmhaven   | Pacific Highway, Charmhaven       | North & South | Distorted images                            | Camera drivers reinstalled, tested OK. | 22/03/2016        | ✓            |
|               |             |              |                                   |               |   |  | Site Ev           | ents: 4      |
| 24/03/2015    | 9623        | Ewingsdale   | Hinterland Way, Ewingsdale        | North & South | Unable to connect to camera                 | Camera power cycled, tested OK.        | 25/03/2015        | <b>✓</b>     |
| 4/11/2015     | 9623        | Ewingsdale   | Hinterland Way, Ewingsdale        | North & South | Images out of focus                         | Focus adjusted, tested OK.             | 11/11/2015        |              |
|               |             |              |                                   |               |   |  | Site Ev           | ents: 2      |
| 13/04/2015    | 9625        | Concord West | Concord Road, Concord West        | North & South | Images out of focus                         | Focus adjusted, tested OK.             | 16/04/2015        |              |
| 1/05/2015     | 9625        | Concord West | Concord Road, Concord West        | North & South | Images out of focus                         | Focus adjusted, tested OK.             | 8/05/2015         |              |
| 16/06/2015    | 9625        | Concord West | Concord Road, Concord West        | North & South | Images out of focus                         | Camera replaced, site certified.       | 19/06/2015        |              |
| 7/07/2015     | 9625        | Concord West | Concord Road, Concord West        | North & South | Images out of focus                         | Camera replaced.                       | 15/07/2015        |              |
|               |             |              |                                   |               |   | Site certified.                        |                   |              |
| 12/11/2015    | 9625        | Concord West | Concord Road, Concord West        | North & South | Images out of focus                         | Camera replaced.                       | 2/12/2015         |              |
|               |             |              |                                   |               |   | Site certified.                        |                   |              |
| 12/02/2016    | 9625        | Concord West | Concord Road, Concord West        | North & South | Unable to connect to camera                 | Connection tested OK.                  | 22/02/2016        | <b>✓</b>     |
|               |             |              |                                   |               |   |  | Site Ev           | ents: 6      |
| 5/05/2015     | 9626        | Caringbah    | Captain Cook Drive, Caringbah     | East          | Flash not discharging                       | Flash relay replaced, tested OK.       | 7/05/2015         |              |
| 11/05/2015    | 9626        | Caringbah    | Captain Cook Drive, Caringbah     | East          | Unable to enable/ disable camera operations |  | 29/06/2015        |              |
|               |             |              |                                   |               |   |  | Site Ev           | ents: 2      |
| 9/06/2016     | 9632        | Urunga       | Pacific Highway, Urunga           | North & South | Unable to connect to camera                 | MPU replaced.                          | 16/06/2016        | <b>✓</b>     |
|               |             |              |                                   |               |   | Site certified.                        |                   |              |
|               |             |              |                                   |               |   |  | Site Ev           | ents: 1      |
| 16/07/2015    | 9635        | Darlinghurst | Eastern Distributor, Darlinghurst | North         | Images dark - night                         | Camera settings adjusted, tested OK.   | 17/07/2015        |              |
| 19/10/2015    | 9635        | Darlinghurst | Eastern Distributor, Darlinghurst | North         | Images dark - night                         | Camera settings adjusted, tested OK.   | 19/10/2015        |              |
| 1771072010    |             |              |                                   |               |   | 0                                      |                   |              |

| Event<br>Date | Site<br>No. | Suburb           | Location                                | Direction     | Sub Category                | Restoration<br>Comments                  | Date<br>Rectified     | Site<br>Down |
|---------------|-------------|------------------|---|---------------|-----------------------------|--|-----------------------|--------------|
| 30/04/2015    | 9636        | Lochinvar(Z)     | New England Highway, Lochinvar          | East & West   | Not creating images         | Site certifiled.                         | 6/05/2015             | <b>✓</b>     |
|               |             |                  |   |               |                             |  | Site Eve              | ents: 1      |
| 27/07/2015    | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Images dark - day           | Camera settings adjusted, tested OK.     | 29/07/2015            |              |
| 31/08/2015    | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Flash not discharging       | Flash circuit breaker reset, tested OK.  | 2/09/2015             |              |
| 10/09/2015    | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Distorted images            | Camera system restarted, tested OK.      | 11/09/2015            |              |
| 15/09/2015    | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Unable to connect to camera | Hard drive (HDD) replaced.               | 23/09/2015            | <b>✓</b>     |
|               |             |                  |   |               |                             | Site certified.                          |                       |              |
| 9/02/2016     | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Flash not discharging       | Flash circuit breaker reset, tested OK.  | 11/02/2016            |              |
| 7/03/2016     | 9640        | Gordon           | Eastern Arterial Road, Gordon           | North & South | Flash not discharging       | Flash circuit breaker reset, tested OK.  | 8/03/2016             |              |
|               |             |                  |   |               |                             |  | Site Eve              | ents: 6      |
| 19/10/2015    | 9641        | Darlinghurst     | Eastern Distributor, Darlinghurst       | South         | Images dark - night         | Camera settings adjusted, tested OK.     | 19/10/2015            |              |
| 16/06/2016    | 9641        | Darlinghurst     | Eastern Distributor, Darlinghurst       | South         | Image review required       | Systems operations verified, test image. | 20/06/2016            |              |
|               |             |                  |   |               |                             |  | Site Eve              | ents: 2      |
| 9/03/2015     | 9642        | North Willoughby | Eastern Valley Way, North<br>Willoughby | North & South | Images black                | Camera connections reseated.             | 13/03/2015            | <b>✓</b>     |
| 7/04/2015     | 9642        | North Willoughby | Eastern Valley Way, North<br>Willoughby | North & South | Images over exposed         | Camera settings adjusted, tested OK.     | 9/04/2015             |              |
| 15/05/2015    | 9642        | North Willoughby | Eastern Valley Way, North<br>Willoughby | North & South | Unable to connect to camera | Hard drive (HDD) replaced.               | 27/05/2015            |              |
| 13/01/2016    | 9642        | North Willoughby | Eastern Valley Way, North<br>Willoughby | North & South | Images black                | Camera settings adjusted, tested OK.     | 19/01/2016            |              |
|               |             |                  |   |               |                             |  | Site Eve              | ents: 4      |
| 17/05/2016    | 9643        | Berkshire Park   | Richmond Road, Berkshire Park           | West & East   | Unable to connect to camera | Camera restarted, tested OK.             | 18/05/2016            | •            |
| 1 //05/2016   | 9643        | Berkshire Park   | Richmond Road, Berkshire Park           | vvest & East  | Unable to connect to camera | Camera restarted, tested UK.             | 18/05/2016<br>Sita Ev |              |

| Event<br>Date | Site<br>No. | Suburb               | Location                                    | Direction     | Sub Category                                | Restoration<br>Comments                     | Date<br>Rectified | Site<br>Down |
|---------------|-------------|----------------------|---|---------------|---|---|-------------------|--------------|
| 2/12/2015     | 9645        | Mount Pritchard      | Elizabeth Drive, Mount Pritchard            | East & West   | Unable to connect to camera                 | Camera power cycled, tested OK.             | 4/12/2015         | <b>✓</b>     |
| 14/12/2015    | 9645        | Mount Pritchard      | Elizabeth Drive, Mount Pritchard            | East & West   | Not generating incidents                    | Restarted camera computer, tested OK.       | 18/12/2015        | •            |
| 2/02/2016     | 9645        | Mount Pritchard      | Elizabeth Drive, Mount Pritchard            | East & West   | Incorrect file name                         | Camera settings modified, tested OK.        | 2/02/2016         |              |
|               |             |                      |   |               |   |   | Site Eve          | rents: 3     |
| 11/06/2015    | 9646        | Padstow              | Gibson Avenue, Padstow                      | North & South | Unable to connect to camera                 | Connection tested OK.                       | 17/06/2015        | •            |
| 30/06/2015    | 9646        | Padstow              | Gibson Avenue, Padstow                      | North & South | Not generating incidents                    | Sensitivity adjusted, tested OK.            | 1/07/2015         | <b>✓</b>     |
| 8/07/2015     | 9646        | Padstow              | Gibson Avenue, Padstow                      | North & South | Images dark - night                         | Flash circuit breaker reset, tested OK.     | 9/07/2015         |              |
| 4/11/2015     | 9646        | Padstow              | Gibson Avenue, Padstow                      | North & South | Unable to connect to camera                 | Camera power cycled, tested OK.             | 9/11/2015         | <b>✓</b>     |
|               |             |                      |   |               |   |   | Site Ev           | ents: 4      |
| 6/11/2015     | 9648        | Woodburn             | Pacific Highway, Woodburn                   | North & South | Not creating images                         | Camera drivers reinstalled, tested OK.      | 10/11/2015        | •            |
|               |             |                      |   |               |   |   | Site Eve          | ents: 1      |
| 20/08/2015    | 9650        | Beauty Point         | Spit Road, Beauty Point                     | North         | Camera requires realignment                 | Camera realigned, tested OK.                | 20/08/2015        |              |
|               |             |                      |   |               |   |   | Site Ev           | ents: 1      |
| 27/01/2016    | 9655        | Lane Cove North      | Lane Cove Tunnel, Lane Cove North           | East          | Unable to enable/ disable camera operations | EC replaced, tested OK.                     | 4/03/2016         |              |
| 9/03/2016     | 9655        | Lane Cove North      | Lane Cove Tunnel, Lane Cove North           | East          | Images black                                | Camera interface board replaced, tested OK. | 11/03/2016        | <b>✓</b>     |
| 9/03/2016     | 9655        | Lane Cove North      | Lane Cove Tunnel, Lane Cove North           | East          | Flash not discharging                       | Flash cables reterminated, tested OK.       | 11/03/2016        | <b>✓</b>     |
| 14/03/2016    | 9655        | Lane Cove North      | Lane Cove Tunnel, Lane Cove North           | East          | Images over exposed                         | Camera settings adjusted, tested OK.        | 14/03/2016        |              |
| 3/05/2016     | 9655        | Lane Cove North      | Lane Cove Tunnel, Lane Cove North           | East          | Unable to connect to camera                 | Connection tested OK.                       | 4/05/2016         | <b>✓</b>     |
|               |             |                      |   |               |   |   | Site Eve          | ents: 5      |
| 20/04/2016    | 9656        | Lane Cove West       | Lane Cove Tunnel, Lane Cove West            | West          | Hard drive disk space (HDD) low             | Obsolete files removed.                     | 26/04/2016        |              |
|               |             |                      |   |               |   |   | Site Ev           | ents: 1      |
| 24/08/2015    | 9657        | North Parramatta (Z) | Pennant Hills Road, North<br>Parramatta (Z) | North         | Images out of focus                         | Camera settings adjusted, tested OK.        | 2/09/2015         |              |
| 8/09/2015     | 9657        | North Parramatta (Z) | Pennant Hills Road, North<br>Parramatta (Z) | North         | Images out of focus                         | Camera settings adjusted, tested OK.        | 16/09/2015        |              |
|               |             |                      |   |               |   |   | Site Ev           | rents: 2     |

| Site<br>Down | Date<br>Rectified | Restoration<br>Comments              | Category                               | Direction   | Location                                 | Suburb         | Site<br>No. | Event<br>Date |
|--------------|-------------------|--------------------------------------|--|-------------|--|----------------|-------------|---------------|
|              | 3/06/2016         | Camera settings adjusted, tested OK. | sh not discharging                     | South       | Pennant Hills Road, Oatlands (Z)         | Oatlands (Z)   | 9658        | 1/06/2016     |
| ents: 1      | Site Eve          |                                      |  |             |  |                |             |               |
| <b>✓</b>     | 16/09/2015        | Obsolete files removed.              | d drive disk space (HDD) low           | North       | Pacific Highway, Ourimbah                | Ourimbah (Z)   | 9660        | 15/09/2015    |
| <b>✓</b>     | 14/10/2015        | Camera wafer board replaced.         | able to connect via Radmin/PC Anywhere | North       | Pacific Highway, Ourimbah                | Ourimbah (Z)   | 9660        | 8/10/2015     |
| <b>✓</b>     | 10/06/2016        | Camera replaced.                     | able to connect to camera              | North       | Pacific Highway, Ourimbah                | Ourimbah (Z)   | 9660        | 3/06/2016     |
|              |                   | Site certified.                      |  |             |  |                |             |               |
| ents: 3      | Site Eve          |                                      |  |             |  |                |             |               |
|              | 1/12/2015         | Camera settings adjusted, tested OK. | torted images                          | South       | Pacific Highway, Ourimbah                | Ourimbah (Z)   | 9661        | 1/12/2015     |
|              | 24/03/2016        | Camera realigned.                    | ages out of focus                      | South       | Pacific Highway, Ourimbah                | Ourimbah (Z)   | 9661        | 9/03/2016     |
|              |                   | Site certified.                      |  |             |  |                |             |               |
| ents: 2      | Site Eve          |                                      |  |             |  |                |             |               |
|              | 15/10/2015        | Camera replaced, site certified.     | ages out of focus                      | East & West | Great Western Highway, Mount<br>Victoria | Mount Victoria | 9666        | 11/08/2015    |
| •            | 8/09/2015         | Obsolete files removed.              | d drive disk space (HDD) low           | East & West | Great Western Highway, Mount<br>Victoria | Mount Victoria | 9666        | 7/09/2015     |
|              | 2/06/2016         | Camera settings adjusted, tested OK. | torted images                          | East & West | Great Western Highway, Mount<br>Victoria | Mount Victoria | 9666        | 31/05/2016    |
| ents: 3      | Site Eve          |                                      |  |             |  |                |             |               |
|              | 21/03/2016        | Camera realigned.                    | nera requires realignment              | East        | Warringah Road, Narraweena               | Narraweena     | 9667        | 18/03/2016    |
|              |                   | Site certified.                      |  |             |  |                |             |               |
|              | 23/05/2016        | Focus adjusted, tested OK.           | ages out of focus                      | East        | Warringah Road, Narraweena               | Narraweena     | 9667        | 20/05/2016    |
| ents: 2      | Site Eve          |                                      |  |             |  |                |             |               |
|              | 8/06/2016         | Camera settings adjusted, tested OK. | ages dark - day                        | North       | Sydney Harbour Tunnel, Sydney            | Sydney         | 9800        | 8/06/2016     |
| ents: 1      | Site Eve          |                                      |  |             |  |                |             |               |
|              | 3/12/2015         | Flash settings adjusted, tested OK.  | ages dark - night                      | East        | Fitzwilliam Road, Toongabbie             | Toongabbie (Z) | 9802        | 2/12/2015     |

| Event<br>Date | Site<br>No. | Suburb             | Location                         | Direction   | Sub Category   | Restoration<br>Comments                        | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------------|----------------------------------|-------------|--|--|-------------------|--------------|
| 20/04/2016    | 9803        | Old Toongabbie (Z) | Fitzwilliam Road, Old Toongabbie | West        | Unable to connect to camera                                    | Camera power supply replaced, tested OK.       | 27/04/2016        | ✓            |
| 10/05/2016    | 9803        | Old Toongabbie (Z) | Fitzwilliam Road, Old Toongabbie | West        | Not creating images  | Camera replaced.                               | 13/05/2016        | <b>✓</b>     |
|               |             |                    |                                  |             |  | Site certifiied.                               |                   |              |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 2      |
| 1/05/2015     | 9804        | Castle Hill (Z)    | Old Northern Road, Castle Hill   | East & West | Images dark - night  | Camera settings adjusted, tested OK.           | 26/05/2015        |              |
| 21/08/2015    | 9804        | Castle Hill (Z)    | Old Northern Road, Castle Hill   | East & West | Images over exposed  | Camera settings adjusted, tested OK.           | 31/08/2015        |              |
| 1/02/2016     | 9804        | Castle Hill (Z)    | Old Northern Road, Castle Hill   | East & West | Flash requires realignment                                     | Flash realigned, tested OK.                    | 5/02/2016         |              |
| 23/05/2016    | 9804        | Castle Hill (Z)    | Old Northern Road, Castle Hill   | East & West | Distorted images   | Camera drivers reinstalled, tested OK.         | 23/05/2016        |              |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 4      |
| 20/06/2016    | 9806        | Guildford (Z)      | Woodville Road, Guildford        | North       | Unable to connect to camera                                    | Hard drive (HDD) replaced.                     | 25/06/2016        | <b>✓</b>     |
|               |             |                    |                                  |             |  | Site certified.                                |                   |              |
| 27/06/2016    | 9806        | Guildford (Z)      | Woodville Road, Guildford        | North       | Unable to enable/ disable camera operations                    | Remote control receiver replaced, tested OK.   | 29/06/2016        |              |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 2      |
| 20/11/2015    | 9810        | Merrylands (Z)     | Merrylands Road, Merrylands      | West & East | Images over exposed  | Camera settings adjusted, tested OK.           | 25/11/2015        |              |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 1      |
| 26/05/2016    | 9811        | Eastgardens (Z)    | Bunnerong Road, Eastgardens      | North       | Unable to connect to camera                                    | Hard drive (HDD) replaced.                     | 3/06/2016         | <b>✓</b>     |
|               |             |                    |                                  |             |  | Site certified.                                |                   |              |
| 7/06/2016     | 9811        | Eastgardens (Z)    | Bunnerong Road, Eastgardens      | North       | Not generating incidents                                       | Camera settings adjusted, tested OK.           | 7/06/2016         | •            |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 2      |
| 5/01/2016     | 9812        | Maroubra (Z)       | Bunnerong Road, Maroubra         | South       | Camera operating as a School Zone (SZ) outside scheduled dates | Scheduled task for SZ reconfigured, tested OK. | 5/01/2016         |              |
| 19/03/2016    | 9812        | Maroubra (Z)       | Bunnerong Road, Maroubra         | South       | Images out of focus  | Focus adjusted, tested OK.                     | 21/03/2016        | •            |
|               |             |                    |                                  |             |  |  | Site Ev           | ents: 2      |
| 17/03/2016    | 9813        | Maroubra (B) (Z)   | Malabar Road, Maroubra B         | North       | Unable to connect to camera                                    | Camera power cycled, tested OK.                | 18/03/2016        | <b>✓</b>     |
| 3/06/2016     | 9813        | Maroubra (B) (Z)   | Malabar Road, Maroubra B         | North       | Unable to connect to camera                                    | Camera power supply replaced, tested OK.       | 8/06/2016         | <b>✓</b>     |

| Event<br>Date | Site<br>No. | Suburb           | Location                 | Direction     | Sub Category                                | Restoration<br>Comments                          | Date<br>Rectified | Site<br>Down |
|---------------|-------------|------------------|--------------------------|---------------|---|--|-------------------|--------------|
| 14/04/2015    | 9814        | Maroubra (B) (Z) | Malabar Road, Maroubra B | South         | Image review required                       | Camera system settings reconfigured, tested OK.  | 27/04/2015        | ✓            |
|               |             |                  |                          |               |   |  | Site Ev           | ents: 1      |
| 1/06/2015     | 9815        | Randwick (Z)     | Avoca Street, Randwick   | North & South | Distorted images                            | Camera replaced.                                 | 26/06/2015        | <b>✓</b>     |
|               |             |                  |                          |               |   | Site certifiled.                                 |                   |              |
| 26/10/2015    | 9815        | Randwick (Z)     | Avoca Street, Randwick   | North & South | Images dark - night                         | Camera settings adjusted, tested OK.             | 6/11/2015         |              |
|               |             |                  |                          |               |   |  | Site Ev           | vents: 2     |
| 9/12/2015     | 9816        | Alexandria (Z)   | Botany Road, Alexandria  | North         | Image review required                       | Camera system settings reconfigured, tested OK.  | 15/12/2015        |              |
| 30/05/2016    | 9816        | Alexandria (Z)   | Botany Road, Alexandria  | North         | Unable to connect to auxiliary camera       | Camera power supply replaced, tested OK.         | 10/06/2016        |              |
|               |             |                  |                          |               |   |  | Site Ev           | vents: 2     |
| 20/05/2015    | 9817        | Rosebery (Z)     | Botany Road, Rosebery    | South         | Unable to connect to camera                 | Camera power supply replaced, tested OK.         | 25/05/2015        | <b>✓</b>     |
|               |             |                  |                          |               |   | Site certified.                                  |                   |              |
| 28/05/2015    | 9817        | Rosebery (Z)     | Botany Road, Rosebery    | South         | Unable to connect to auxiliary camera       | Camera power cycled, tested OK.                  | 28/05/2015        | ✓            |
| 7/08/2015     | 9817        | Rosebery (Z)     | Botany Road, Rosebery    | South         | Images dark - day                           | Camera settings adjusted, tested OK.             | 17/08/2015        |              |
|               |             |                  |                          |               |   |  | Site Ev           | ents: 3      |
| 14/04/2015    | 9818        | Bankstown (Z)    | Hume Highway, Bankstown  | East          | Unable to connect to camera                 | Hard Disk Drive (HDD) re-imaged. Site certified. | 17/04/2015        | <b>✓</b>     |
| 27/04/2015    | 9818        | Bankstown (Z)    | Hume Highway, Bankstown  | East          | Not generating incidents                    | System power cycled, tested OK.                  | 29/04/2015        | <b>✓</b>     |
| 14/12/2015    | 9818        | Bankstown (Z)    | Hume Highway, Bankstown  | East          | Not generating incidents                    | System rebooted, tested OK.                      | 22/12/2015        | <b>✓</b>     |
| 19/02/2016    | 9818        | Bankstown (Z)    | Hume Highway, Bankstown  | East          | Images over exposed                         | Camera settings adjusted, tested OK.             | 24/02/2016        |              |
| 1/03/2016     | 9818        | Bankstown (Z)    | Hume Highway, Bankstown  | East          | Images out of focus                         | Focus adjusted, tested OK.                       | 3/03/2016         |              |
|               |             |                  |                          |               |   |  | Site Ev           | vents: 5     |
| 17/12/2015    | 9819        | Bankstown (Z)    | Hume Highway, Bankstown  | West          | Unable to enable/ disable camera operations |  | 6/01/2016         | <b>✓</b>     |

| Event<br>Date | Site<br>No. | Suburb            | Location                         | Direction     | Sub Category  | Restoration<br>Comments                      | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------------|----------------------------------|---------------|---|--|-------------------|--------------|
| 15/10/2015    | 9820        | Ashfield (Z)      | Hume Highway, Ashfield           | East & West   | Unable to connect to camera                           | Motherboard replaced.                        | 26/10/2015        | <b>✓</b>     |
|               |             |                   |                                  |               |   | Site certified.                              |                   |              |
| 20/11/2015    | 9820        | Ashfield (Z)      | Hume Highway, Ashfield           | East & West   | Datablock details require modification                | Datablock details modified, tested OK.       | 23/11/2015        |              |
|               |             |                   |                                  |               |   |  | Site Eve          | ents: 2      |
| 6/05/2015     | 9821        | Liverpool (Z)     | Bigge Street, Liverpool          | North & South | Not creating images                                   | Site certifiied.                             | 8/05/2015         |              |
|               |             |                   |                                  |               |   |  | Site Eve          | ents: 1      |
| 6/05/2015     | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Distorted images                                      | Camera settings adjusted, tested OK.         | 8/05/2015         |              |
| 11/05/2015    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | System vehicle statistic data mismatching image count | Camera settings adjusted, tested OK.         | 13/05/2015        |              |
| 30/06/2015    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Unable to connect to camera                           | Hard drive (HDD) replaced.                   | 9/07/2015         | <b>✓</b>     |
|               |             |                   |                                  |               |   | Site certified.                              |                   |              |
| 13/07/2015    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Images out of focus                                   | Camera settings adjusted, tested OK.         | 17/07/2015        |              |
| 12/10/2015    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Images over exposed                                   | Light meter adjusted, tested OK.             | 14/10/2015        |              |
| 11/01/2016    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Unable to enable/ disable camera operations           | Remote control receiver replaced, tested OK. | 10/02/2016        |              |
| 7/03/2016     | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Unable to connect to camera                           | Camera wafer board replaced.                 | 18/03/2016        | <b>✓</b>     |
|               |             |                   |                                  |               |   | Site certified.                              |                   |              |
| 18/03/2016    | 9822        | Beverly Hills (Z) | King Georges Road, Beverly Hills | North         | Camera requires realignment                           | Camera realigned.                            | 22/03/2016        |              |
|               |             |                   |                                  |               |   |  | Site Eve          | ents: 8      |
| 14/12/2015    | 9823        | Beverly Hills (Z) | King Georges Road, Beverly Hills | South         | Not generating incidents                              | Restarted camera computer, tested OK.        | 18/12/2015        | <b>✓</b>     |

| Event<br>Date | Site<br>No. | Suburb              | Location                      | Direction     | Sub Category                                | Restoration<br>Comments                  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|---------------------|-------------------------------|---------------|---|--|-------------------|--------------|
| 23/04/2015    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images out of focus                         | Camera settings adjusted, tested OK.     | 24/04/2015        |              |
| 21/05/2015    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images over exposed                         | Camera settings adjusted, tested OK.     | 21/05/2015        |              |
| 12/06/2015    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images out of focus                         | Camera settings adjusted, tested OK.     | 17/06/2015        |              |
| 12/06/2015    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Unable to enable/ disable camera operations | Power cable reseated.                    | 23/06/2015        |              |
| 24/11/2015    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images out of focus                         | Focus adjusted, tested OK.               | 30/11/2015        |              |
| 8/01/2016     | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Unable to connect to camera                 | Camera power supply replaced, tested OK. | 20/01/2016        | •            |
| 2/02/2016     | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Not creating images                         | Camera replaced.                         | 8/02/2016         | <b>✓</b>     |
|               |             |                     |                               |               |   | Site certified.                          |                   |              |
| 18/02/2016    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images out of focus                         | Focus adjusted, tested OK.               | 22/02/2016        |              |
| 18/02/2016    | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Flash not discharging                       | Camera settings adjusted, tested OK.     | 19/02/2016        |              |
| 7/06/2016     | 9824        | Lindfield (Z)       | Pacific Highway, Lindfield    | East          | Images out of focus                         | Camera settings adjusted, tested OK.     | 8/06/2016         | <b>✓</b>     |
|               |             |                     |                               |               |   |  | Site Eve          | nts: 10      |
| 24/06/2015    | 9827        | Narrabeen (Z)       | Pittwater Road, Narrabeen     | South         | Not generating incidents                    | Sensitivity adjusted, tested OK.         | 30/06/2015        |              |
|               |             |                     |                               |               |   |  | Site Ev           | ents: 1      |
| 14/06/2016    | 9829        | Penshurst (Z)       | Forest Road, Penshurst        | East & West   | Images dark - night                         | Flash replaced.                          | 16/06/2016        |              |
| 15/06/2016    | 9829        | Penshurst (Z)       | Forest Road, Penshurst        | East & West   | Unable to enable/ disable camera operations | Power cable reseated, tested OK.         | 20/06/2016        |              |
|               |             |                     |                               |               |   |  | Site Ev           | vents: 2     |
| 11/03/2015    | 9830        | Hurstville (Z)      | Forest Road, Hurstville       | North & South | Not creating images                         | Power supply replaced.                   | 17/03/2015        | •            |
|               |             |                     |                               |               |   |  | Site Ev           | ents: 1      |
| 30/04/2015    | 9831        | North Curl Curl (Z) | Harbord Road, North Curl Curl | North & South | Not generating incidents                    | System rebooted, tested OK.              | 5/05/2015         | <b>✓</b>     |
| 8/05/2015     | 9831        | North Curl Curl (Z) | Harbord Road, North Curl Curl | North & South | Unable to connect to camera                 | Connection tested OK.                    | 13/05/2015        | <b>✓</b>     |
| 15/03/2016    | 9831        | North Curl Curl (Z) | Harbord Road, North Curl Curl | North & South | Not generating incidents                    | Camera settings adjusted, tested OK.     | 17/03/2016        |              |
|               |             |                     |                               |               |   | Camera settings adjusted, tested         |                   |              |

| Event<br>Date | Site<br>No. | Suburb         | Location                     | Direction   | Sub Category                                | Restoration<br>Comments                         | Date<br>Rectified | Site<br>Down |
|---------------|-------------|----------------|------------------------------|-------------|---|---|-------------------|--------------|
| 20/04/2015    | 9832        | Bonnyrigg (Z)  | Cabramatta Road, Bonnyrigg   | East & West | Image review required                       | Camera system settings reconfigured, tested OK. | 21/04/2015        |              |
| 4/11/2015     | 9832        | Bonnyrigg (Z)  | Cabramatta Road, Bonnyrigg   | East & West | Unable to connect to camera                 | Site certified.                                 | 25/11/2015        | <b>✓</b>     |
| 8/02/2016     | 9832        | Bonnyrigg (Z)  | Cabramatta Road, Bonnyrigg   | East & West | Distorted images                            | Camera system restarted, tested OK.             | 8/02/2016         | •            |
|               |             |                |                              |             |   |   | Site Ev           | vents: 3     |
| 24/03/2015    | 9833        | Miranda (Z)    | Kingsway, Miranda            | East        | Unable to connect to camera                 | Camera enabled.                                 | 25/03/2015        | •            |
|               |             |                |                              |             |   |   | Site Ev           | ents: 1      |
| 27/10/2015    | 9835        | Ryde (Z)       | Victoria Road, Ryde          | East        | Unable to connect to camera                 | Connection tested OK.                           | 30/10/2015        |              |
|               |             |                |                              |             |   |   | Site Ev           | vents: 1     |
| 8/01/2015     | 9836        | Ryde (Z)       | Victoria Road, Ryde          | West        | Unable to enable/ disable camera operations | PLC cable replaced.                             | 23/03/2015        |              |
|               |             |                |                              |             |   |   | Site Ev           | vents: 1     |
| 5/11/2015     | 9837        | Moore Park (Z) | Cleveland Street, Moore Park | East        | Images dark - night                         | Camera replaced.                                | 10/12/2015        |              |
|               |             |                |                              |             |   | Site certified.                                 |                   |              |
| 4/12/2015     | 9837        | Moore Park (Z) | Cleveland Street, Moore Park | East        | Unable to connect to camera                 | Camera settings adjusted, tested OK.            | 8/12/2015         | •            |
| 18/02/2016    | 9837        | Moore Park (Z) | Cleveland Street, Moore Park | East        | Unable to connect to camera                 | MPU replaced.                                   | 25/02/2016        | <b>✓</b>     |
|               |             |                |                              |             |   | Site certified.                                 |                   |              |
| 20/06/2016    | 9837        | Moore Park (Z) | Cleveland Street, Moore Park | East        | Images black                                | Camera system restarted, tested OK.             | 21/06/2016        | •            |
|               |             |                |                              |             |   |   | Site Ev           | vents: 4     |
| 20/04/2015    | 9838        | Moore Park (Z) | Cleveland Street, Moore Park | West        | Time Server (RMS)                           | GPS time server replaced.                       | 8/05/2015         |              |
| 25/02/2016    | 9838        | Moore Park (Z) | Cleveland Street, Moore Park | West        | Flash not discharging                       | Flash circuit breaker reset, tested OK.         | 3/03/2016         |              |
|               |             |                |                              |             |   |   |                   |              |

| Event<br>Date | Site<br>No. | Suburb              | Location                        | Direction | Sub Category                | Restoration<br>Comments                    | Date<br>Rectified | Site<br>Down |
|---------------|-------------|---------------------|---------------------------------|-----------|-----------------------------|--|-------------------|--------------|
| 16/07/2015    | 9842        | Chester Hill (Z)    | Woodville Road, Chester Hill    | South     | Distorted images            | Camera replaced.                           | 20/07/2015        | <b>✓</b>     |
|               |             |                     |                                 |           | Ü                           | Site certifiled.                           |                   |              |
| 15/10/2015    | 9842        | Chester Hill (Z)    | Woodville Road, Chester Hill    | South     | Not creating images         | Camera system power cycled, tested OK.     | 15/10/2015        | •            |
| 21/10/2015    | 9842        | Chester Hill (Z)    | Woodville Road, Chester Hill    | South     | Images too red              | Camera drivers reinstalled, tested OK.     | 28/10/2015        |              |
| 14/12/2015    | 9842        | Chester Hill (Z)    | Woodville Road, Chester Hill    | South     | Not generating incidents    | Restarted camera computer, tested OK.      | 22/12/2015        | •            |
| 9/02/2016     | 9842        | Chester Hill (Z)    | Woodville Road, Chester Hill    | South     | Images too red              | Camera replaced.                           | 11/02/2016        |              |
|               |             |                     |                                 |           |                             | Site certified.                            |                   |              |
|               |             |                     |                                 |           |                             |  | Site Ev           | ents: 5      |
| 26/05/2015    | 9843        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | North     | Distorted images            | Camera replaced.                           | 20/07/2015        | <b>✓</b>     |
|               |             |                     |                                 |           |                             | Site certifiled.                           |                   |              |
|               |             |                     |                                 |           |                             |  | Site Ev           | ents: 1      |
| 25/08/2015    | 9844        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | South     | Images out of focus         | Focus adjusted, tested OK.                 | 2/09/2015         |              |
| 20/10/2015    | 9844        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | South     | Images dark - day           | Camera settings adjusted, tested OK.       | 21/10/2015        |              |
| 2/12/2015     | 9844        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | South     | Distorted images            | Camera drivers reinstalled, tested OK.     | 3/12/2015         |              |
| 2/02/2016     | 9844        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | South     | Images out of focus         | Camera replaced.                           | 11/02/2016        |              |
|               |             |                     |                                 |           |                             | Site certified.                            |                   |              |
| 17/02/2016    | 9844        | Wahroonga (Z)       | Pacific Highway, Wahroonga      | South     | Flash not discharging       | Flash tested OK, camera settings adjusted. | 18/02/2016        |              |
|               |             |                     |                                 |           |                             |  | Site Ev           | ents: 5      |
| 13/05/2016    | 9846        | Kingswood (Z)       | Parker Street, Kingswood        | South     | Unable to connect to camera | Hard drive (HDD) reimaged.                 | 17/05/2016        | <b>✓</b>     |
|               |             |                     |                                 |           |                             | Hard drive (HDD) replaced.                 |                   | _            |
|               |             |                     |                                 |           |                             | Site certified.                            |                   |              |
|               |             |                     |                                 |           |                             |  | Site Ev           | ents: 1      |
| 7/03/2016     | 9847        | North Narrabeen (Z) | Pittwater Road, North Narrabeen | North     | Images dark - night         | Camera settings adjusted, tested OK.       | 9/03/2016         |              |
|               |             |                     |                                 |           |                             |  | Site Ev           | ents: 1      |

| Event<br>Date | Site<br>No. | Suburb              | Location                        | Direction     | Sub Category                   | Restoration<br>Comments                 | Date<br>Rectified | Site<br>Down |
|---------------|-------------|---------------------|---------------------------------|---------------|--------------------------------|---|-------------------|--------------|
| 18/03/2016    | 9848        | North Narrabeen (Z) | Pittwater Road, North Narrabeen | South         | Images dark - night            | Flash circuit breaker reset, tested OK. | 18/03/2016        |              |
| 6/06/2016     | 9848        | North Narrabeen (Z) | Pittwater Road, North Narrabeen | South         | Distorted images               | Camera system restarted, tested OK.     | 6/06/2016         |              |
|               |             |                     |                                 |               |                                |   | Site Eve          | ents: 2      |
| 10/12/2015    | 9849        | Strathfield (Z)     | The Boulevarde, Strathfield     | North & South | Horizontal bands across images | Camera settings adjusted, tested OK.    | 11/12/2015        |              |
| 8/01/2016     | 9849        | Strathfield (Z)     | The Boulevarde, Strathfield     | North & South | Horizontal bands across images | Camera cable replaced, tested OK.       | 11/01/2016        | <b>✓</b>     |
|               |             |                     |                                 |               |                                |   | Site Eve          | ents: 2      |
| 26/04/2016    | 9851        | Condell Park (Z)    | Edgar Street, Condell Park      | North & South | Images out of focus            | Focus adjusted, tested OK.              | 2/05/2016         |              |
| 26/04/2016    | 9851        | Condell Park (Z)    | Edgar Street, Condell Park      | North & South | Images dark - night            | Camera settings adjusted, tested OK.    | 27/04/2016        |              |
|               |             |                     |                                 |               |                                | Flash circuit breaker reset, tested OK. |                   |              |

**Total FDSC Maintenance Events: 250** 

| Event<br>Date | Site<br>No. | Suburb       | Location   | Direction | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|--|-----------|--|--|-------------------|--------------|
| RLSC Cam      | neras       |              |  |           |  |  |                   |              |
| 9/06/2016     | 7103        | Campbelltown | Moore Oxley Bypass (Westbound)<br>at the intersection with Broughton<br>Street, Campbelltown | West      | Images dark - night  | Camera settings adjusted, tested OK.                           | 15/06/2016        |              |
|               |             |              |  |           |  |  | Site Ev           | /ents: 1     |
| 29/06/2016    | 7104        | Campbelltown | Moore Oxley Bypass (Eastbound) at<br>the intersection with Broughton<br>Street, Campbelltown | East      | Video file   | Camera system restarted, tested OK.                            | 4/07/2016         |              |
|               |             |              |  |           |  |  | Site Ev           | ents: 1      |
| 13/07/2015    | 7106        | Zetland      | Bourke Street at the intersection with Botany Road, Zetland                                  | West      | Flash continuously discharging                                   | Camera system restarted, tested OK.                            | 16/07/2015        | •            |
| 21/08/2015    | 7106        | Zetland      | Bourke Street at the intersection with Botany Road, Zetland                                  | West      | Not generating incidents   | System operations verified.                                    | 25/08/2015        | ✓            |
| 11/04/2016    | 7106        | Zetland      | Bourke Street at the intersection with Botany Road, Zetland                                  | West      | Not creating images  | System operation verified.                                     | 14/04/2016        |              |
|               |             |              |  |           |  |  | Site Ev           | ents: 3      |
| 4/08/2015     | 7107        | Parramatta   | Victoria Road at the intersection with Church Street, Parramatta                             | West      | Hard drive disk space (HDD) low                                  | Hard drive (HDD) replaced. Site certified.                     | 6/08/2015         | ✓            |
|               |             |              |  |           |  |  | Site Ev           | vents: 1     |
| 28/04/2015    | 7108        | Cabramatta   | Cumberland Highway (Southbound) at the intersection with Cabramatta Road West, Cabramatta    | South     | Not generating incidents   | Sensitivity adjusted, tested OK.                               | 1/06/2015         |              |
| 18/01/2016    | 7108        | Cabramatta   | Cumberland Highway (Southbound) at the intersection with Cabramatta Road West, Cabramatta    | South     | Flash not discharging  | Flash enabled, tested OK.                                      | 8/03/2016         |              |
|               |             |              |  |           |  |  | Site Ev           | vents: 2     |
| 5/04/2016     | 7110        | Campbelltown | Kellicar Road (Eastbound) at the intersection with Narellan Road, Campbelltown               | East      | Excessive images   | Road surface resheeted, new sensors installed. Site certified. | 27/05/2016        |              |
|               |             |              |  |           |  |  | Site Ev           | /ents: 1     |
| 4/12/2015     | 7111        | Campbelltown | Kellicar Road (Westbound) at the intersection with Narellan Road, Campbelltown               | West      | Traffic light inputs not displayed via<br>Enforcement Controller | Enforcement Controller replaced, tested OK.                    | 15/12/2015        |              |
| 29/03/2016    | 7111        | Campbelltown | Kellicar Road (Westbound) at the intersection with Narellan Road, Campbelltown               | West      | Flash continuously discharging                                   | Flash operations tested OK.                                    | 29/03/2016        |              |

| Event<br>Date | Site<br>No. | Suburb      | Location   | Direction | Sub Category  | Restoration<br>Comments                          | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------|--|-----------|---|--|-------------------|--------------|
| 23/02/2016    | 7112        | Auburn      | Silverwater Road at the intersection with M4 Western Motorway On-Ramp (Westbound), Auburn      | North     | Images out of focus   | Focus adjusted, tested OK.                       | 24/02/2016        | •            |
| 29/02/2016    | 7112        | Auburn      | Silverwater Road at the intersection with M4 Western Motorway On-Ramp (Westbound), Auburn      | North     | No connection to Enforcement Controller.<br>Traffic light simulation unavailable. | Enforcement Controller reset, tested OK.         | 2/03/2016         |              |
|               |             |             |  |           |   |  | Site Ev           | vents: 2     |
| 24/03/2015    | 7113        | Silverwater | Silverwater Road at the intersection with M4 Western Motorway On-Ramp (Eastbound), Silverwater | South     | Not generating incidents  | Enforcement Controller (EC) replaced, tested OK. | 2/04/2015         |              |
|               |             |             |  |           |   |  | Site Ev           | ents: 1      |
| 22/04/2015    | 7114        | Wiley Park  | Canterbury Road at the intersection with King Georges Road, Wiley Park                         | East      | Not generating incidents  | Restarted camera computer, tested OK.            | 22/04/2015        |              |
| 11/05/2015    | 7114        | Wiley Park  | Canterbury Road at the intersection with King Georges Road, Wiley Park                         | East      | Unable to connect to camera   | Hard drive (HDD) replaced. Site certified.       | 18/05/2015        | •            |
| 26/04/2016    | 7114        | Wiley Park  | Canterbury Road at the intersection with King Georges Road, Wiley Park                         | East      | Horizontal bands across images  | Camera replaced, tested OK. Site certified.      | 29/04/2016        | •            |
| 13/05/2016    | 7114        | Wiley Park  | Canterbury Road at the intersection with King Georges Road, Wiley Park                         | East      | Unable to connect to camera   | Camera power supply replaced, tested OK.         | 19/05/2016        | <b>✓</b>     |
|               |             |             |  |           |   |  | Site Ev           | vents: 4     |
| 29/03/2016    | 7115        | Roselands   | Canterbury Road at the intersection with King Georges Road, Roselands                          | West      | Flash continuously discharging  | Flash operations tested OK.                      | 30/03/2016        | <b>✓</b>     |

| Event<br>Date | Site<br>No. | Suburb      | Location   | Direction | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------|--|-----------|--|--|-------------------|--------------|
| 31/07/2015    | 7118        | Westmead    | Great Western Highway at the intersection with Hawkesbury Road, Westmead       | East      | Not creating images  | Power restored to network equipment, tested OK.                  | 7/08/2015         |              |
| 26/11/2015    | 7118        | Westmead    | Great Western Highway at the intersection with Hawkesbury Road, Westmead       | East      | Video camera   | Camera restarted, tested OK.                                     | 4/12/2015         |              |
| 21/12/2015    | 7118        | Westmead    | Great Western Highway at the   | East      | Not creating images  | Camera hub replaced, tested OK.                                  | 31/12/2015        |              |
|               |             |             | intersection with Hawkesbury Road,<br>Westmead                                 |           |  | Main Processing Unit (MPU) replaced.                             |                   |              |
|               |             |             |  |           |  | Site certified.  |                   |              |
| 31/12/2015    | 7118        | Westmead    | Great Western Highway at the<br>intersection with Hawkesbury Road,<br>Westmead | East      | Traffic light inputs not displayed via<br>Enforcement Controller | Reterminated connection to<br>Enforcement Controller, tested OK. | 18/01/2016        |              |
| 4/02/2016     | 7118        | Westmead    | Great Western Highway at the intersection with Hawkesbury Road, Westmead       | East      | Not creating images  | Connections reterminated.  | 12/02/2016        |              |
| 2/03/2016     | 7118        | Westmead    | Great Western Highway at the intersection with Hawkesbury Road, Westmead       | East      | Traffic light inputs not displayed via<br>Enforcement Controller | Reterminated connection to<br>Enforcement Controller, tested OK. | 4/03/2016         | ✓            |
|               |             |             |  |           |  |  | Site Ev           | /ents: 6     |
| 12/02/2016    | 7120        | Surry Hills | South Dowling Street at the intersection with Fitzroy Street, Surry Hills      | North     | Flash requires realignment                                       | Flash realigned, tested OK.                                      | 15/02/2016        |              |
|               |             |             |  |           |  |  | Site Ev           | ents: 1      |
| 16/04/2015    | 7121        | Paddington  | South Dowling Street at the intersection with Moore Park Road, Paddington      | South     | Flash not discharging  | Flash bulb replaced, tested OK.                                  | 17/04/2015        |              |
|               |             |             |  |           |  |  | Site Ev           | vents: 1     |
| 25/06/2015    | 7122        | St Marys    | Great Western Highway at the intersection with Charles Hackett Drive, St Marys | East      | Flash not discharging  | Flash bulb replaced, tested OK.                                  | 7/07/2015         |              |
|               |             |             |  |           |  |  | Cito Ev           | ants: 1      |

| Event<br>Date | Site<br>No. | Suburb       | Location  | Direction | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|---|-----------|--|--|-------------------|--------------|
| 2/03/2015     | 7123        | St Marys     | Great Western Highway at the intersection with Pages Road, St Marys | West      | Not generating incidents   | Supplier replaced parts in camera,<br>tested OK.<br>Main Processing Unit replaced<br>(MPU) | 12/03/2015        | ✓            |
| 13/11/2015    | 7123        | St Marys     | Great Western Highway at the intersection with Pages Road, St Marys | West      | Video file   | Video camera refocused.  | 13/11/2015        |              |
| 24/03/2016    | 7123        | St Marys     | Great Western Highway at the intersection with Pages Road, St Marys | West      | Not generating incidents   | TIRTL lens cleaned, systems operations verified.   | 1/04/2016         | <b>✓</b>     |
|               |             |              |   |           |  |  | Site Ev           | ents: 3      |
| 31/07/2015    | 7124        | Chester Hill | Waldron Road at the intersection with Hector Street, Chester Hill   | East      | Traffic light inputs not displayed via<br>Enforcement Controller | Enforcement Controller replaced, tested OK.  | 6/08/2015         |              |
| 31/07/2015    | 7124        | Chester Hill | Waldron Road at the intersection with Hector Street, Chester Hill   | East      | Not generating incidents   | Camera settings adjusted, tested OK.   | 11/08/2015        | <b>✓</b>     |
| 13/01/2016    | 7124        | Chester Hill | Waldron Road at the intersection with Hector Street, Chester Hill   | East      | Video camera   | Video camera settings modified, tested OK.   | 13/01/2016        |              |
| 12/02/2016    | 7124        | Chester Hill | Waldron Road at the intersection with Hector Street, Chester Hill   | East      | Unable to connect to camera                                      | Circuit breaker reset, tested OK.  | 15/02/2016        | <b>✓</b>     |
| 16/03/2016    | 7124        | Chester Hill | Waldron Road at the intersection with Hector Street, Chester Hill   | East      | Not creating images  | Video camera system power cycled, tested OK.   | 17/03/2016        |              |
|               |             |              |   |           |  |  | Site Ev           | ents: 5      |
| 2/03/2015     | 7125        | Sefton       | Waldron Road at the intersection with Hector Street, Sefton         | West      | Not generating incidents   | Main Processing Unit replaced (MPU)<br>Site certified.                                     | 12/03/2015        | ✓            |
|               |             |              |   |           |  |  | Site Ev           | ents: 1      |
| 17/03/2015    | 7127        | Villawood    | Woodville Road at the intersection with Hume Highway, Villawood     | South     | Images out of focus  | Focus adjusted, tested OK.   | 18/03/2015        |              |
| 27/07/2015    | 7127        | Villawood    | Woodville Road at the intersection with Hume Highway, Villawood     | South     | Unable to connect to camera                                      | Hard drive (HDD) replaced. Site certified.   | 3/08/2015         | ✓            |
|               |             |              |   |           |  |  | Site Ev           | ents: 2      |
| 2/12/2015     | 7129        | Concord      | Parramatta Road at the intersection with Burwood Road, Concord      | East      | Video camera   | Camera restarted, tested OK.   | 3/12/2015         |              |
|               |             |              |   |           |  |  | 011 5             |              |

| Event<br>Date | Site<br>No. | Suburb         | Location   | Direction | Sub Category   | Restoration<br>Comments                   | Date<br>Rectified | Site<br>Down |
|---------------|-------------|----------------|--|-----------|--|---|-------------------|--------------|
| 20/03/2015    | 7131        | Rockdale       | Princes Highway at the intersection with Bay Street, Rockdale                              | South     | Images out of focus  | Focus adjusted, tested OK.                | 27/03/2015        |              |
| 15/07/2015    | 7131        | Rockdale       | Princes Highway at the intersection with Bay Street, Rockdale                              | South     | Excessive images   |   | 11/08/2015        |              |
| 17/03/2016    | 7131        | Rockdale       | Princes Highway at the intersection with Bay Street, Rockdale                              | South     | Unable to connect to camera                                      | Camera restarted, tested OK.              | 18/03/2016        | ✓            |
|               |             |                |  |           |  |   | Site Ev           | ents: 3      |
| 27/05/2015    | 7139        | Darlinghurst   | Craigend Street at the intersection with McLachlan Avenue, Darlinghurst                    | West      | Video camera requires realignment                                | Video camera realigned, tested OK.        | 3/06/2015         |              |
|               |             |                |  |           |  |   | Site Ev           | ents: 1      |
| 23/06/2015    | 7140        | Moore Park.    | Anzac Parade at the intersection with Moore Park Road, Moore Park                          | North     | Unable to connect to camera                                      | MPU replaced. Site certified.             | 6/07/2015         | <b>✓</b>     |
|               |             |                |  |           |  |   | Site Ev           | ents: 1      |
| 2/12/2015     | 7144        | Granville      | Woodville Road at the intersection with M4 Western Motorway On-Ramp (Westbound), Granville | North     | Traffic light inputs not displayed via<br>Enforcement Controller | Traffic signal inputs visible, tested OK. | 3/12/2015         |              |
| 1/06/2016     | 7144        | Granville      | Woodville Road at the intersection with M4 Western Motorway On-Ramp (Westbound), Granville | North     | Video file   | Camera system restarted, tested OK.       | 2/06/2016         |              |
|               |             |                |  |           |  |   | Site Ev           | ents: 2      |
| 17/08/2015    | 7146        | Baulkham Hills | Windsor Road at the intersection with Old Northern Road, Baulkham Hills                    | East      | Images out of focus  | Focus adjusted, tested OK.                | 19/08/2015        |              |
| 8/02/2016     | 7146        | Baulkham Hills | Windsor Road at the intersection<br>with Old Northern Road, Baulkham<br>Hills              | East      | Video file   | Video camera refocused.                   | 9/02/2016         |              |
| 14/04/2016    | 7146        | Baulkham Hills | Windsor Road at the intersection<br>with Old Northern Road, Baulkham<br>Hills              | East      | Video camera   | Camera restarted, tested OK.              | 19/04/2016        |              |
|               |             |                |  |           |  |   |                   |              |

| Event<br>Date | Site<br>No. | Suburb      | Location  | Direction | Sub Category                                       | Restoration<br>Comments   | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------|---|-----------|--|---|-------------------|--------------|
| 27/04/2015    | 7148        | Liverpool   | Hume Highway at the intersection                                      | South     | Distorted images                                   | Camera replaced.  | 30/04/2015        |              |
|               |             |             | with Elizabeth Drive, Liverpool                                       |           |  | Site certifiled.  |                   |              |
| 27/01/2016    | 7148        | Liverpool   | Hume Highway at the intersection with Elizabeth Drive, Liverpool      | South     | Unable to connect to camera                        | Connection tested OK.   | 28/01/2016        | •            |
| 10/05/2016    | 7148        | Liverpool   | Hume Highway at the intersection with Elizabeth Drive, Liverpool      | South     | Unable to connect to camera                        | Connections reseated.   | 23/05/2016        |              |
|               |             |             |   |           |  |   | Site Ev           | ents: 3      |
| 27/01/2016    | 7149        | Milperra    | Newbridge Road at the intersection with Henry Lawson Drive, Milperra  | East      | Unable to connect to camera                        | Cable replaced, tested OK.  | 1/02/2016         | <b>✓</b>     |
| 4/02/2016     | 7149        | Milperra    | Newbridge Road at the intersection with Henry Lawson Drive, Milperra  | East      | Unable to connect to camera                        | Hard drive (HDD) replaced. Site certified.                          | 8/02/2016         | ✓            |
|               |             |             |   |           |  |   | Site Ev           | vents: 2     |
| 9/06/2015     | 7150        | Castle Hill | Showground Road at the intersection with Victoria Avenue, Castle Hill | West      | Not creating images                                | Video camera replaced, tested OK. Video camera replaced, tested OK. | 10/06/2015        |              |
| 22/09/2015    | 7150        | Castle Hill | Showground Road at the intersection with Victoria Avenue, Castle Hill | West      | Flash continuously discharging                     | Flash trigger cable rewired.  | 14/10/2015        |              |
|               |             |             |   |           |  |   | Site Ev           | vents: 2     |
| 23/03/2016    | 7151        | Paddington  | Moore Park Road at the intersection with Lang Road,                   | East      | Flash not discharging                              | Flash enabled, tested OK.   | 24/03/2016        |              |
| 12/04/2016    | 7151        | Paddington  | Moore Park Road at the intersection with Lang Road,                   | East      | Not creating images                                | System operation verified.  | 14/04/2016        |              |
| 4/06/2016     | 7151        | Paddington  | Moore Park Road at the intersection with Lang Road,                   | East      | Flash not discharging                              | Flash replaced.   | 9/06/2016         |              |
| 17/06/2016    | 7151        | Paddington  | Moore Park Road at the intersection with Lang Road,                   | East      | Video file   | Camera system restarted, tested OK.                                 | 20/06/2016        |              |
| 24/06/2016    | 7151        | Paddington  | Moore Park Road at the intersection with Lang Road,                   | East      | Video file   | Video processor card replaced, tested OK.                           | 28/06/2016        |              |
|               |             |             |   |           |  |   | Site Ev           | ents: 5      |
| 12/08/2015    | 7152        | Rozelle     | Wellington Street at the intersection with Victoria Road, Rozelle     | South     | Unable to control flash via Enforcement Controller | Flash tested OK.  | 15/09/2015        |              |
|               |             |             |   |           |  |   | CII F             | rombo. 1     |

| Event<br>Date | Site<br>No. | Suburb      | Location  | Direction | Sub Category                                | Restoration<br>Comments                     | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-------------|---|-----------|---|---|-------------------|--------------|
| 8/12/2015     | 7153        | Lidcombe    | Olympic Drive at the intersection with Vaughan Street, Lidcombe       | North     | Unable to connect to camera                 | Hard drive (HDD) replaced. Site certified.  | 24/12/2015        | <b>✓</b>     |
| 15/01/2016    | 7153        | Lidcombe    | Olympic Drive at the intersection with Vaughan Street, Lidcombe       | North     | Unable to enable/ disable camera operations | EC rebooted, tested OK.                     | 18/01/2016        |              |
| 12/04/2016    | 7153        | Lidcombe    | Olympic Drive at the intersection with Vaughan Street, Lidcombe       | North     | Not creating images                         | Video card (DVP) replaced.                  | 12/04/2016        |              |
| 1/06/2016     | 7153        | Lidcombe    | Olympic Drive at the intersection with Vaughan Street, Lidcombe       | North     | Video file                                  | Camera system restarted, tested OK.         | 2/06/2016         |              |
| 9/06/2016     | 7153        | Lidcombe    | Olympic Drive at the intersection with Vaughan Street, Lidcombe       | North     | Incident file size                          | Camera settings adjusted, tested OK.        | 21/06/2016        |              |
|               |             |             |   |           |   |   | Site Ev           | rents: 5     |
| 19/06/2015    | 7154        | Strathfield | Arthur Street at the intersection with Centenary Drive, Strathfield   | East      | Excessive images                            | System operation verified.                  | 24/06/2015        |              |
| 9/10/2015     | 7154        | Strathfield | Arthur Street at the intersection with Centenary Drive, Strathfield   | East      | Excessive images                            | Loop settings reconfigured, tested OK.      | 13/10/2015        |              |
| 9/11/2015     | 7154        | Strathfield | Arthur Street at the intersection with Centenary Drive, Strathfield   | East      | Images out of focus                         | Camera system restarted, tested OK.         | 12/11/2015        |              |
|               |             |             |   |           |   |   | Site Ev           | ents: 3      |
| 1/05/2015     | 7156        | Petersham   | Parramatta Road at the intersection with West Street, Petersham       | West      | Images dark - night                         | Camera settings adjusted, tested OK.        | 7/05/2015         |              |
| 11/03/2016    | 7156        | Petersham   | Parramatta Road at the intersection with West Street, Petersham       | West      | Not generating incidents                    | Power supply replaced/replugged, tested OK. | 16/03/2016        | •            |
|               |             |             |   |           |   |   | Site Ev           | ents: 2      |
| 4/01/2016     | 7159        | Cabramatta  | Cumberland Highway at the intersection with St Johns Road, Cabramatta | South     | Images out of focus                         |   | 7/01/2016         |              |
| 30/06/2016    | 7159        | Cabramatta  | Cumberland Highway at the intersection with St Johns Road, Cabramatta | South     | Images dark - night                         | Flash settings adjusted, tested OK.         | 1/07/2016         |              |
|               |             |             |   |           |   |   | Site Ev           | rents: 2     |
| 17/03/2015    | 7160        | Blacktown   | Bungarribee Road at the intersection with Balmoral Street, Blacktown  | East      | Image review required                       | Connections reterminated.                   | 20/03/2015        |              |
| 24/03/2015    | 7160        | Blacktown   | Bungarribee Road at the intersection with Balmoral Street, Blacktown  | East      | Video camera                                | Video camera replaced, tested OK.           | 30/03/2015        |              |
|               |             |             |   |           |   |   | Site Ev           | rents: 2     |

| Event<br>Date | Site<br>No. | Suburb             | Location   | Direction | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------------|--|-----------|--|--|-------------------|--------------|
| 7/09/2015     | 7161        | Pennant Hills (Z)  | Pennant Hills Road at the intersection with Beecroft Road, Pennant Hills (Z)     | West      | Unable to connect to camera                                      | Camera restarted, tested OK.   | 10/09/2015        | ✓            |
|               |             |                    |  |           |  |  | Site Ev           | ents: 1      |
| 31/05/2016    | 7162        | Caringbah          | Kingsway at the intersection with Gannons Road, Caringbah                        | West      | Traffic light inputs not displayed via<br>Enforcement Controller | Traffic signal inputs visible, tested OK.                                | 22/06/2016        |              |
|               |             |                    |  |           |  |  | Site Ev           | ents: 1      |
| 6/10/2015     | 7165        | West Pennant Hills | Pennant Hills Road at the<br>Intersection with Eaton Road, West<br>Pennant Hills | North     | Zoom adjustment required   | Unable to adjust zoom, optimum settings configured.                      | 7/10/2015         |              |
|               |             |                    |  |           |  |  | Site Ev           | ents: 1      |
| 13/07/2015    | 7168        | Blacktown          | Great Western Highway at the intersection with Reservoir Road, Blacktown         | West      | Not creating images  | System operation verified.   | 21/07/2015        |              |
| 23/02/2016    | 7168        | Blacktown          | Great Western Highway at the intersection with Reservoir Road, Blacktown         | West      | Images over exposed  | Camera system restarted, tested OK. Camera settings adjusted, tested OK. | 24/02/2016        |              |
|               |             |                    |  |           |  |  | Site Ev           | ents: 2      |
| 10/09/2015    | 7169        | Roselands          | King Georges Road at the intersection with Moorefields Road, Roselands           | North     | Flash not discharging  | Flash replaced.  | 15/09/2015        |              |
| 2/12/2015     | 7169        | Roselands          | King Georges Road at the intersection with Moorefields Road, Roselands           | North     | Traffic light inputs not displayed via<br>Enforcement Controller | Traffic signal inputs visible, tested OK.                                | 3/12/2015         |              |
|               |             |                    |  |           |  |  | Site Ev           | ents: 2      |
| 19/02/2016    | 7170        | Blacktown (Z)      | Newton Road at the intersection with Flushcombe Road, Blacktown (Z)              | West      | Unable to connect to camera                                      | MPU replaced. Site certified.  | 29/02/2016        | <b>✓</b>     |

| Event<br>Date | Site<br>No. | Suburb       | Location  | Direction | Sub Category                    | Restoration<br>Comments                         | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|---|-----------|---------------------------------|---|-------------------|--------------|
| 20/05/2015    | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Images dark - night             | Camera system restarted, tested OK.             | 20/05/2015        |              |
| 9/12/2015     | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Not generating incidents        | Restarted camera computer, tested OK.           | 11/12/2015        | ✓            |
| 7/01/2016     | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Images out of focus             | Focus adjusted, tested OK.                      | 7/01/2016         |              |
| 14/01/2016    | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Not creating images             | Camera system settings reconfigured, tested OK. | 18/01/2016        |              |
| 4/02/2016     | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Not generating incidents        | System operations verified.                     | 18/03/2016        | ✓            |
| 9/06/2016     | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Images dark - night             | Flash settings adjusted, tested OK.             | 9/06/2016         |              |
| 20/06/2016    | 7171        | Haberfield   | Dobroyd Parade at the intersection with Mortley Avenue, Haberfield  | West      | Video camera                    | Video camera settings modified, tested OK.      | 21/06/2016        |              |
|               |             |              |   |           |                                 |   | Site Ev           | ents: 7      |
| 3/08/2015     | 7173        | Guildford    | Woodville Road at the intersection with Guildford Road, Guildford   | North     | Hard drive disk space (HDD) low | Obsolete files removed.                         | 3/08/2015         |              |
|               |             |              |   |           |                                 |   | Site Ev           | ents: 1      |
| 2/04/2015     | 7174        | Crows Nest   | Pacific Highway at the intersection with Hume Street, Crows Nest    | North     | Unable to connect to camera     | Connection tested OK.                           | 13/04/2015        | •            |
| 30/04/2015    | 7174        | Crows Nest   | Pacific Highway at the intersection with Hume Street, Crows Nest    | North     | Not generating incidents        | System rebooted, tested OK.                     | 5/05/2015         |              |
| 6/11/2015     | 7174        | Crows Nest   | Pacific Highway at the intersection with Hume Street, Crows Nest    | North     | Unable to connect to camera     | Cable replaced, tested OK.                      | 11/11/2015        | <b>✓</b>     |
|               |             |              |   |           |                                 |   | Site Ev           | ents: 3      |
| 1/10/2015     | 7175        | Rockdale     | Bestic Street at the intersection with West Botany Street, Rockdale | West      | Video file                      | Video camera replaced, tested OK.               | 2/10/2015         |              |
|               |             |              |   |           |                                 |   | Site Ev           | ents: 1      |
| 6/08/2015     | 7176        | Warwick Farm | Hume Highway at the intersection with Bigge Street, Warwick Farm    | West      | Unable to connect to camera     | Hard drive (HDD) replaced. Site certified.      | 11/08/2015        | •            |
|               |             |              |   |           |                                 |   |                   |              |

| Event<br>Date | Site<br>No. | Suburb        | Location  | Direction | Sub Category                | Restoration<br>Comments                    | Date<br>Rectified | Site<br>Down |
|---------------|-------------|---------------|---|-----------|-----------------------------|--|-------------------|--------------|
| 2/06/2015     | 7177        | Thornleigh    | Pennant Hills Road at the   | North     | Images out of focus         | Camera replaced.                           | 4/06/2015         |              |
|               |             |               | intersection with Parkes Street,<br>Thornleigh                        |           |                             | Site certified.                            |                   |              |
| 10/03/2016    | 7177        | Thornleigh    | Pennant Hills Road at the intersection with Parkes Street, Thornleigh | North     | Flash not discharging       | Flash enabled, tested OK.                  | 17/03/2016        |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 2     |
| 12/06/2015    | 7178        | Moore Park    | Anzac Parade at the intersection with Lang Road, Moore Park           | South     | Flash not discharging       | Flash replaced.                            | 15/06/2015        |              |
| 4/12/2015     | 7178        | Moore Park    | Anzac Parade at the intersection with Lang Road, Moore Park           | South     | Video file                  | Camera system restarted, tested OK.        | 8/12/2015         | ✓            |
| 10/02/2016    | 7178        | Moore Park    | Anzac Parade at the intersection with Lang Road, Moore Park           | South     | Flash not discharging       | Flash replaced.                            | 15/02/2016        |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 3     |
| 9/04/2015     | 7180        | Ashfield      | Frederick Street at the intersection with Hume Highway, Ashfield      | South     | Unable to connect to camera | Hard drive (HDD) replaced. Site certified. | 28/04/2015        |              |
| 29/06/2016    | 7180        | Ashfield      | Frederick Street at the intersection with Hume Highway, Ashfield      | South     | Video file                  | Video camera replaced, tested OK.          | 6/07/2016         |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 2     |
| 6/06/2016     | 7181        | Moorebank     | Newbridge Road at the intersection with Stockton Avenue, Moorebank    | West      | Video file                  | Camera housing lens replaced.              | 8/06/2016         |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 1     |
| 21/04/2016    | 7188        | Ultimo        | Wattle Street at the intersection with William Henry Street, Ultimo   | North     | Video camera                | Video camera settings modified, tested OK. | 26/04/2016        |              |
| 1/06/2016     | 7188        | Ultimo        | Wattle Street at the intersection with William Henry Street, Ultimo   | North     | Video file                  | Camera system restarted, tested OK.        | 2/06/2016         |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 2     |
| 9/04/2015     | 7190        | Mascot        | O'Riordan Street at the intersection with Coward Street, Mascot       | South     | Unable to connect to camera | Connection tested OK.                      | 15/04/2015        | <b>✓</b>     |
| 21/04/2015    | 7190        | Mascot        | O'Riordan Street at the intersection                                  | South     | Unable to connect to camera | Camera replaced, site certified.           | 10/07/2015        |              |
|               |             |               | with Coward Street, Mascot  |           |                             | Cable replaced, tested OK.                 |                   |              |
|               |             |               |   |           |                             |  | Site Ev           | vents: 2     |
| 3/06/2015     | 7191        | South Penrith | Parker Street at the intersection with Jamison Road, South Penrith    | North     | Not generating incidents    | Restarted camera computer, tested OK.      | 4/06/2015         | <b>✓</b>     |
|               |             |               |   |           |                             |  | Site Ev           | ents: 1      |

| Event<br>Date | Site<br>No. | Suburb         | Location  | Direction | Sub Category                  | Restoration<br>Comments                                    | Date<br>Rectified | Site<br>Down |
|---------------|-------------|----------------|---|-----------|-------------------------------|--|-------------------|--------------|
| 24/04/2015    | 7192        | Bondi Junction | Old South Head Road at the intersection with Bondi Road, Bondi Junction | West      | Not generating incidents      | System rebooted, tested OK.                                | 24/04/2015        | ✓            |
| 1/05/2015     | 7192        | Bondi Junction | Old South Head Road at the intersection with Bondi Road, Bondi Junction | West      | Camera requires realignment   | Camera realigned, tested OK.                               | 5/05/2015         |              |
| 14/08/2015    | 7192        | Bondi Junction | Old South Head Road at the intersection with Bondi Road, Bondi Junction | West      | Not generating incidents      | System operations verified.                                | 3/09/2015         | ✓            |
| 9/02/2016     | 7192        | Bondi Junction | Old South Head Road at the intersection with Bondi Road, Bondi Junction | West      | Not generating incidents      | System operations verified, vendor advises sensor related. | 18/03/2016        |              |
|               |             |                |   |           |                               |  | Site Ev           | ents: 4      |
| 7/04/2015     | 7193        | Blacktown      | Sunnyholt Road at the intersection with Main Street, Blacktown          | South     | Not creating images           | Video camera system power cycled, tested OK.               | 7/04/2015         | <b>✓</b>     |
| 24/04/2015    | 7193        | Blacktown      | Sunnyholt Road at the intersection with Main Street, Blacktown          | South     | Not creating images           | Camera system settings reconfigured, tested OK.            | 15/05/2015        |              |
| 18/05/2015    | 7193        | Blacktown      | Sunnyholt Road at the intersection with Main Street, Blacktown          | South     | Camera response time slow     | Hard disk drive (HDD) replaced.<br>Site certified.         | 26/05/2015        |              |
|               |             |                |   |           |                               |  | Site Ev           | ents: 3      |
| 19/04/2016    | 7194        | Dee Why        | Pittwater Road at the intersection with Harbord Road, Dee Why           | South     | Not generating incidents      | System power cycled, tested OK.                            | 19/04/2016        | <b>✓</b>     |
|               |             |                |   |           |                               |  | Site Eve          | ents: 1      |
| 9/04/2015     | 7195        | Kogarah Bay    | Park Road at the intersection with Princes Highway, Kogarah Bay         | North     | Unable to connect to camera   | Fibre optic media converter replaced.                      | 14/05/2015        | <b>✓</b>     |
| 12/06/2015    | 7195        | Kogarah Bay    | Park Road at the intersection with<br>Princes Highway, Kogarah Bay      | North     | Flash not discharging         | Flash controller reset, tested OK.                         | 12/06/2015        |              |
| 23/06/2015    | 7195        | Kogarah Bay    | Park Road at the intersection with<br>Princes Highway, Kogarah Bay      | North     | Image numbers out of sequence | Camera system settings reconfigured, tested OK.            | 23/06/2015        |              |
| 13/01/2016    | 7195        | Kogarah Bay    | Park Road at the intersection with<br>Princes Highway, Kogarah Bay      | North     | Video camera                  | Video camera hardware replaced, tested OK.                 | 28/01/2016        |              |
| 20/04/2016    | 7195        | Kogarah Bay    | Park Road at the intersection with<br>Princes Highway, Kogarah Bay      | North     | Not generating incidents      | System operations verified.                                | 20/04/2016        |              |
|               |             |                |   |           |                               |  | Site Eve          | ents: 5      |
| 28/06/2016    | 7196        | Blacktown (Z)  | Lancaster Street at the intersection with Kildare Road, Blacktown (Z)   | South     | Not generating incidents      | Sensitivity adjusted, tested OK.                           | 30/06/2016        | <b>✓</b>     |
|               |             |                |   |           |                               |  | Site Ev           | ents: 1      |

| Event<br>Date | Site<br>No. | Suburb       | Location   | Direction | Sub Category                          | Restoration<br>Comments                     | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|--|-----------|---------------------------------------|---|-------------------|--------------|
| 1/02/2016     | 7198        | Kirrawee     | Acacia Road at the intersection with President Avenue, Kirrawee        | South     | Not generating incidents              | Restarted camera computer, tested OK.       | 2/02/2016         | •            |
| 3/06/2016     | 7198        | Kirrawee     | Acacia Road at the intersection with<br>President Avenue, Kirrawee     | South     | Unable to connect to camera           | Hard drive (HDD) replaced.                  | 9/06/2016         | <b>✓</b>     |
|               |             |              | Fresident Avenue, Kirrawee   |           |                                       | Site certified.                             |                   |              |
|               |             |              |  |           |                                       |   | Site Ev           | rents: 2     |
| 15/04/2016    | 7201        | Smithfield   | Victoria Street at the intersection with Hassall Street, Smithfield    | West      | Horizontal bands across images        | Camera system restarted, tested OK.         | 18/04/2016        |              |
| 18/04/2016    | 7201        | Smithfield   | Victoria Street at the intersection                                    | West      | Hard drive disk space (HDD) low       | Hard drive (HDD) replaced.                  | 5/05/2016         |              |
|               |             |              | with Hassall Street, Smithfield  |           |                                       | Site certified.                             |                   |              |
|               |             |              |  |           |                                       |   | Site Ev           | rents: 2     |
| 22/04/2015    | 7202        | Marrickville | Sydenham Road at the intersection with Victoria Road, Marrickville     | East      | Flash not discharging                 | Flash replaced.                             | 29/04/2015        |              |
| 21/05/2015    | 7202        | Marrickville | Sydenham Road at the intersection with Victoria Road, Marrickville     | East      | Not generating incidents              | Camera connections reterminated, tested OK. | 26/05/2015        | <b>✓</b>     |
| 2/12/2015     | 7202        | Marrickville | Sydenham Road at the intersection with Victoria Road, Marrickville     | East      | Flash continuously discharging        | Flash operations tested OK.                 | 2/12/2015         |              |
| 22/12/2015    | 7202        | Marrickville | Sydenham Road at the intersection with Victoria Road, Marrickville     | East      | Not generating incidents              | System rebooted, tested OK.                 | 22/12/2015        | •            |
|               |             |              |  |           |                                       |   | Site Ev           | rents: 4     |
| 21/05/2015    | 7203        | Ryde         | Victoria Road at the intersection with Devlin Street, Ryde             | West      | Flash not discharging                 | Flash controller reset, tested OK.          | 21/05/2015        |              |
| 4/11/2015     | 7203        | Ryde         | Victoria Road at the intersection with Devlin Street, Ryde             | West      | Images dark - night                   | Flash settings adjusted, tested OK.         | 5/11/2015         |              |
| 8/03/2016     | 7203        | Ryde         | Victoria Road at the intersection with Devlin Street, Ryde             | West      | Not generating incidents              | Restarted camera computer, tested OK.       | 9/03/2016         | ✓            |
|               |             |              |  |           |                                       |   | Site Ev           | rents: 3     |
| 18/02/2016    | 7206        | Kingsgrove   | Bexley Road at the intersection with William Street, Kingsgrove        | North     | Unable to connect to camera           | Connection tested OK.                       | 26/02/2016        | ✓            |
|               |             |              |  |           |                                       |   | Site Ev           | rents: 1     |
| 26/02/2016    | 7207        | Redfern (Z)  | Chalmers Street at the intersection with Cleveland Street, Redfern (Z) | North     | Unable to connect to auxiliary camera | Camera power cycled, tested OK.             | 26/02/2016        | •            |
|               |             |              |  |           |                                       |   | Sito Ev           | ants: 1      |

| Event<br>Date | Site<br>No. | Suburb        | Location  | Direction | Sub Category                                | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|---------------|---|-----------|---|--|-------------------|--------------|
| 23/11/2015    | 7208        | Kensington    | Anzac Parade at the intersection with Todman Avenue, Kensington       | North     | Horizontal bands across images              | Camera system restarted, tested OK.                              | 23/11/2015        | <b>✓</b>     |
| 18/02/2016    | 7208        | Kensington    | Anzac Parade at the intersection with Todman Avenue, Kensington       | North     | Unable to connect to camera                 | Cable replaced, tested OK.  Camera settings adjusted, tested OK. | 23/02/2016        | ✓            |
| 22/04/2016    | 7208        | Kensington    | Anzac Parade at the intersection with Todman Avenue, Kensington       | North     | Flash not discharging                       | Flash replaced.  | 29/04/2016        |              |
|               |             |               |   |           |   |  | Site Ev           | vents: 3     |
| 25/05/2015    | 7210        | Haberfield    | Parramatta Road at the intersection with Sloane Street, Haberfield    | East      | Unable to connect to camera                 | Camera setttings adjusted, tested OK.                            | 25/05/2015        | <b>✓</b>     |
|               |             |               |   |           |   |  | Site Ev           | ents: 1      |
| 11/05/2016    | 7212        | Hamilton East | Pacific Highway at the intersection with Parry Street, Hamilton East  | North     | Flash not discharging                       | Flash controller reset, tested OK.                               | 11/05/2016        |              |
| 29/06/2016    | 7212        | Hamilton East | Pacific Highway at the intersection with Parry Street, Hamilton East  | North     | Images dark - night                         | Flash settings adjusted, tested OK.                              | 29/06/2016        |              |
|               |             |               |   |           |   |  | Site Ev           | vents: 2     |
| 1/07/2015     | 7213        | Lambton       | Griffiths Road at the intersection with Turton Road, Lambton          | East      | Unable to enable/ disable camera operations | EC replaced, tested OK.  | 2/07/2015         |              |
| 17/11/2015    | 7213        | Lambton       | Griffiths Road at the intersection with Turton Road, Lambton          | East      | Unable to connect to camera                 | Circuit breaker reset, tested OK.                                | 18/11/2015        | <b>✓</b>     |
| 1/06/2016     | 7213        | Lambton       | Griffiths Road at the intersection with Turton Road, Lambton          | East      | Video file                                  | Camera system restarted, tested OK.                              | 3/06/2016         |              |
|               |             |               |   |           |   |  | Site Ev           | vents: 3     |
| 9/03/2015     | 7214        | Mayfield West | Pacific Highway at the intersection with Maud Street, Mayfield West   | West      | Flash continuously discharging              | Flash circuit breaker reset, tested OK.                          | 10/03/2015        |              |
|               |             |               |   |           |   |  | Site Ev           | ents: 1      |
| 4/05/2015     | 7215        | Hamilton      | Tudor Street at the intersection with Beaumont Street, Hamilton       | West      | Images dark - night                         | Camera settings adjusted, tested OK.                             | 5/05/2015         |              |
|               |             |               |   |           |   |  | Site Ev           | ents: 1      |
| 24/04/2015    | 7216        | Wollongong    | Gladstone Avenue at the intersection with Princes Highway, Wollongong | North     | Unable to connect to camera                 | Power restored to site.  | 27/04/2015        | •            |
|               |             |               |   |           |   |  | Site Ev           | vents: 1     |

| Event<br>Date | Site<br>No. | Suburb     | Location   | Direction | Sub Category                | Restoration<br>Comments                          | Date<br>Rectified | Site<br>Down |
|---------------|-------------|------------|--|-----------|-----------------------------|--|-------------------|--------------|
| 21/05/2015    | 7217        | Unanderra  | Princes Highway at the intersection with Five Islands Road, Unanderra                            | South     | Not generating incidents    | Camera settings adjusted, tested OK.             | 26/05/2015        |              |
| 23/02/2016    | 7217        | Unanderra  | Princes Highway at the intersection with Five Islands Road, Unanderra                            | South     | Camera requires realignment | Camera realigned. Site certified.                | 24/02/2016        |              |
|               |             |            |  |           |                             |  | Site Ev           | /ents: 2     |
| 5/04/2016     | 7218        | Wollongong | Corrimal Street at the intersection with Burelli Street, Wollongong                              | North     | Images out of focus         | Image quality verified, no further action taken. | 20/04/2016        |              |
|               |             |            |  |           |                             |  | Site Ev           | ents: 1      |
| 4/06/2015     | 7219        | Figtree    | Princes Highway at the intersection with O'Briens Road, Figtree                                  | North     | Flash not discharging       | Flash cables reterminated, tested OK.            | 23/06/2015        |              |
|               |             |            |  |           |                             |  | Site Ev           | /ents: 1     |
| 22/06/2016    | 7220        | Windang    | Windang Road at the intersection with Boronia Avenue, Windang                                    | North     | Unable to connect to camera | Connection tested OK.                            | 23/06/2016        | •            |
|               |             |            |  |           |                             |  | Site Ev           | /ents: 1     |
| 1/09/2015     | 7223        | Auburn     | M4 Western Motorway Off-Ramp<br>(Westbound) at the intersection<br>with Silverwater Road, Auburn | West      | Unable to connect to camera | Hard drive (HDD) replaced. Site certified.       | 9/09/2015         | •            |
| 3/03/2016     | 7223        | Auburn     | M4 Western Motorway Off-Ramp<br>(Westbound) at the intersection<br>with Silverwater Road, Auburn | West      | Video file                  | Video processor card replaced, tested OK.        | 15/03/2016        |              |
|               |             |            |  |           |                             |  | Site Ev           | /ents: 2     |
| 13/04/2015    | 7240        | Haberfield | Ramsay Street at the intersection with Wattle Street, Haberfield                                 | South     | Unable to connect to camera | Hard drive (HDD) replaced. Site certified.       | 24/04/2015        | ✓            |
| 4/06/2015     | 7240        | Haberfield | Ramsay Street at the intersection with Wattle Street, Haberfield                                 | South     | Unable to connect to camera | Connection tested OK.                            | 9/06/2015         | <b>✓</b>     |
| 21/07/2015    | 7240        | Haberfield | Ramsay Street at the intersection with Wattle Street, Haberfield                                 | South     | Unable to connect to camera | Camera replaced. Site certified.                 | 29/07/2015        | ✓            |
| 26/05/2016    | 7240        | Haberfield | Ramsay Street at the intersection with Wattle Street, Haberfield                                 | South     | Video camera                | Video camera replaced, tested OK.                | 27/05/2016        |              |
|               |             |            |  |           |                             |  | Site Ev           | vents: 4     |
| 24/03/2015    | 7243        | Haymarket  | George Street at the intersection with Pitt Street, Haymarket                                    | South     | Unable to connect to camera | Connection tested OK.                            | 27/03/2015        | •            |
| 26/05/2015    | 7243        | Haymarket  | George Street at the intersection with Pitt Street, Haymarket                                    | South     | Flash not discharging       | Flash controller reset, tested OK.               | 29/05/2015        |              |
|               |             |            |  |           |                             |  | Sita Ev           | /ents: 2     |

| Event<br>Date | Site<br>No. | Suburb     | Location  | Direction | Sub Category   | Restoration<br>Comments  | Date<br>Rectified | Site<br>Down |
|---------------|-------------|------------|---|-----------|--|--|-------------------|--------------|
| 12/04/2016    | 7246        | Campsie    | Canterbury Road at the intersection with Thorncraft Parade, Campsie | East      | Not creating images  | Camera system rebooted, tested OK.                               | 13/04/2016        |              |
|               |             |            |   |           |  |  | Site Ev           | ents: 1      |
| 28/05/2015    | 7248        | Bankstown  | Stacey Street at the intersection with Hume Highway, Bankstown      | North     | Not creating images  | Video card (DVP) replaced.                                       | 9/06/2015         | •            |
| 25/11/2015    | 7248        | Bankstown  | Stacey Street at the intersection with Hume Highway, Bankstown      | North     | Traffic light inputs not displayed via<br>Enforcement Controller | Reterminated connection to<br>Enforcement Controller, tested OK. | 3/12/2015         |              |
|               |             |            |   |           |  | Traffic signal inputs visible, tested OK.                        |                   |              |
| 6/04/2016     | 7248        | Bankstown  | Stacey Street at the intersection with Hume Highway, Bankstown      | North     | Flash continuously discharging                                   | Camer settings adjusted, tested OK.                              | 7/04/2016         |              |
| 22/06/2016    | 7248        | Bankstown  | Stacey Street at the intersection with Hume Highway, Bankstown      | North     | Distorted images   | Camera system restarted, tested OK.                              | 22/06/2016        |              |
|               |             |            |   |           |  |  | Site Ev           | ents: 4      |
| 24/02/2016    | 7249        | Parramatta | O'Connell Street at the intersection with Argyle Street, Parramatta | South     | Unable to connect to camera                                      | MPU replaced. Site certified.                                    | 11/03/2016        | ✓            |
|               |             |            |   |           |  |  | Site Ev           | ents: 1      |
| 9/10/2015     | 7250        | Auburn     | Chisholm Road at the intersection with Mona Street, Auburn          | North     | Images over exposed  | Light meter adjusted, tested OK.                                 | 12/10/2015        |              |
| 22/01/2016    | 7250        | Auburn     | Chisholm Road at the intersection with Mona Street, Auburn          | North     | Flash continuously discharging                                   | Site certified.  | 29/01/2016        | •            |
|               |             |            |   |           |  |  | Site Ev           | rents: 2     |
| 17/03/2015    | 7251        | Leichhardt | City West Link at the intersection with James Street, Leichhardt    | West      | Images out of focus  | Camera replaced.<br>Site certified.                              | 19/03/2015        |              |
|               |             |            |   |           |  |  | Site Ev           | ents: 1      |
| 13/07/2015    | 7252        | Concord    | Broughton Street at the intersection with Crane Street, Concord     | South     | Video file   | Video camera refocused.  | 13/07/2015        |              |
| 9/10/2015     | 7252        | Concord    | Broughton Street at the intersection with Crane Street, Concord     | South     | Not generating incidents   | Sensitivity adjusted, tested OK.                                 | 13/10/2015        |              |
|               |             |            |   |           |  |  | Site Ev           | rents: 2     |
| 17/03/2016    | 7253        | Liverpool  | Memorial Avenue at the intersection with Bathurst Street, Liverpool | East      | System event log notification                                    | Operations verified, no further action required.                 | 24/03/2016        |              |
|               |             |            |   |           |  |  | Site Ev           | rents: 1     |

| Event<br>Date | Site<br>No. | Suburb         | Location  | Direction | Sub Category                                | Restoration<br>Comments                              | Date<br>Rectified | Site<br>Down |
|---------------|-------------|----------------|---|-----------|---|--|-------------------|--------------|
| 2/07/2015     | 7254        | North Ryde (Z) | Lane Cove Road (Southbound) at<br>the intersection with Cox's Road,<br>North Ryde (Z) | South     | Images not transferring to archive folder/s | Camera restarted, tested OK.                         | 3/07/2015         |              |
|               |             |                |   |           |   |  | Site Ev           | ents: 1      |
| 23/07/2015    | 7270        | North Ryde (Z) | Lane Cove Road (Northbound) at<br>the intersection with Cox's Road,<br>North Ryde (Z) | North     | Hard drive disk space (HDD) low             | Obsolete files removed.                              | 23/07/2015        |              |
| 1/09/2015     | 7270        | North Ryde (Z) | Lane Cove Road (Northbound) at<br>the intersection with Cox's Road,<br>North Ryde (Z) | North     | Unable to connect to camera                 | Power restored to site.                              | 1/09/2015         | ✓            |
| 23/10/2015    | 7270        | North Ryde (Z) | Lane Cove Road (Northbound) at<br>the intersection with Cox's Road,<br>North Ryde (Z) | North     | Video file                                  | Video camera replaced, tested OK.                    | 16/11/2015        |              |
|               |             |                |   |           |   |  | Site Ev           | ents: 3      |
| 9/10/2015     | 7271        | Lakemba        | Punchbowl Road at the intersection with Wangee Road, Lakemba                          | West      | Not generating incidents                    | Restarted camera computer, tested OK.                | 12/10/2015        |              |
| 11/03/2016    | 7271        | Lakemba        | Punchbowl Road at the intersection with Wangee Road, Lakemba                          | West      | Not creating images                         | Main Processing Unit (MPU) replaced. Site certified. | 17/03/2016        | ✓            |
|               |             |                |   |           |   |  | Site Ev           | ents: 2      |
| 9/12/2015     | 7272        | Bankstown      | Edgar Street at the intersection with Marion Street, Bankstown                        | South     | Not creating images                         | Camera connections reterminated, tested OK.          | 14/12/2015        | •            |
|               |             |                |   |           |   |  | Site Ev           | ents: 1      |
| 28/07/2015    | 7273        | Seven Hills    | Abbott Road at the intersection with Station Road, Seven Hills                        | West      | Flash not discharging                       | Flash circuit breaker reset, tested OK.              | 7/08/2015         |              |
| 26/11/2015    | 7273        | Seven Hills    | Abbott Road at the intersection with Station Road, Seven Hills                        | West      | Unable to connect to auxiliary camera       | Hard drive (HDD) replaced. Site certified.           | 7/12/2015         |              |
| 5/01/2016     | 7273        | Seven Hills    | Abbott Road at the intersection with Station Road, Seven Hills                        | West      | Unable to connect to auxiliary camera       | Connection tested OK.                                | 7/01/2016         |              |
| 15/06/2016    | 7273        | Seven Hills    | Abbott Road at the intersection with Station Road, Seven Hills                        | West      | Video camera                                | Video camera settings modified, tested OK.           | 21/06/2016        |              |
|               |             |                |   |           |   |  | Site Ev           | ents: 4      |

| Event<br>Date | Site<br>No. | Suburb       | Location   | Direction | Sub Category                                | Restoration<br>Comments                              | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|--|-----------|---|--|-------------------|--------------|
| 18/05/2015    | 7274        | Mount Druitt | Great Western Highway at the intersection with Carlisle Avenue, Mount Druitt | East      | Images over exposed                         | Light meter connections reseated, tested OK.         | 10/06/2015        | ✓            |
| 12/10/2015    | 7274        | Mount Druitt | Great Western Highway at the intersection with Carlisle Avenue, Mount Druitt | East      | Images over exposed                         | Camera system restarted, tested OK.                  | 15/10/2015        |              |
|               |             |              |  |           |   |  | Site Ev           | ents: 2      |
| 1/05/2015     | 7275        | Croydon Park | Georges River Road at the intersection with Croydon Avenue, Croydon Park     | East      | Unable to connect to camera                 | Camera setttings adjusted, tested OK.                | 1/05/2015         | •            |
|               |             |              |  |           |   |  | Site Ev           | ents: 1      |
| 1/10/2015     | 7276        | Bradbury     | Moore Oxley Bypass at the intersection with The Parkway, Bradbury            | South     | Not generating incidents                    | System power cycled, tested OK.                      | 1/10/2015         | ✓            |
| 19/10/2015    | 7276        | Bradbury     | Moore Oxley Bypass at the intersection with The Parkway, Bradbury            | South     | Unable to connect to camera                 | Site controller replaced, tested OK. Site certified. | 27/10/2015        | ✓            |
|               |             |              |  |           |   |  | Site Ev           | ents: 2      |
| 15/06/2016    | 7277        | Belfield     | Burwood Road at the intersection with Punchbowl Road, Belfield               | North     | Unable to enable/ disable camera operations | Power cable reseated, tested OK.                     | 20/06/2016        |              |
|               |             |              |  |           |   |  | Site Ev           | ents: 1      |
| 12/02/2016    | 7279        | Fairfield    | The Horsley Drive at the intersection with Polding Street, Fairfield         | North     | Not generating incidents                    | Camera settings adjusted, tested OK.                 | 12/02/2016        | •            |
|               |             |              |  |           |   |  | Site Ev           | ents: 1      |
| 27/05/2015    | 7280        | Smithfield   | Cumberland Highway at the intersection with The Horsley Drive, Smithfield    | South     | Not generating incidents                    | Circuit breaker reset, tested OK.                    | 4/06/2015         | ✓            |
| 9/06/2015     | 7280        | Smithfield   | Cumberland Highway at the intersection with The Horsley Drive, Smithfield    | South     | Unable to connect to camera                 | Camera power cycled, tested OK.                      | 11/06/2015        | •            |
| 3/09/2015     | 7280        | Smithfield   | Cumberland Highway at the intersection with The Horsley Drive, Smithfield    | South     | Flash requires realignment                  | Flash realigned, tested OK.                          | 8/09/2015         |              |
|               |             |              |  |           |   |  | Cito Fu           |              |

| Event<br>Date | Site<br>No. | Suburb       | Location  | Direction | Sub Category   | Restoration<br>Comments                              | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|---|-----------|--|--|-------------------|--------------|
| 21/07/2015    | 7281        | Smithfield   | The Horsley Drive at the intersection with Gipps Street, Smithfield             | West      | Unable to connect to camera                                      | Site controller replaced, tested OK. Site certified. | 23/07/2015        | •            |
| 21/08/2015    | 7281        | Smithfield   | The Horsley Drive at the intersection with Gipps Street, Smithfield             | West      | Unable to connect to camera                                      | Cable replaced, tested OK.                           | 26/08/2015        | ✓            |
|               |             |              |   |           |  |  | Site Ev           | ents: 2      |
| 21/12/2015    | 7283        | Northmead    | Briens Road at the intersection with Redbank Road, Northmead                    | West      | Images out of focus  | Focus adjusted, tested OK.                           | 22/12/2015        |              |
| 15/04/2016    | 7283        | Northmead    | Briens Road at the intersection with Redbank Road, Northmead                    | West      | Images out of focus  | Camera component replaced. Site certified.           | 21/04/2016        | <b>✓</b>     |
|               |             |              |   |           |  |  | Site Eve          | ents: 2      |
| 11/03/2016    | 7284        | St Marys (Z) | Mamre Road at the intersection with Saddington Street, St Marys (Z)             | South     | Not creating images  | System operation verified.                           | 14/03/2016        | •            |
|               |             |              |   |           |  |  | Site Eve          | ents: 1      |
| 11/03/2015    | 7285        | Randwick     | Alison Road at the intersection with Avoca Street, Randwick                     | West      | Images black   | Paint removed from camera housing lens.              | 13/03/2015        | <b>✓</b>     |
|               |             |              |   |           |  |  | Site Eve          | ents: 1      |
| 3/08/2015     | 7287        | Alexandria   | Collins Street at the intersection with O'Riordan Street, Alexandria            | East      | Traffic light inputs not displayed via<br>Enforcement Controller | Traffic signal inputs visible, tested OK.            | 12/08/2015        |              |
|               |             |              |   |           |  |  | Site Eve          | ents: 1      |
| 8/03/2016     | 7289        | Wallsend     | Thomas Street at the intersection with Metcalfe Street, Wallsend                | West      | Images dark - night  | Flash replaced.                                      | 18/03/2016        |              |
| 17/05/2016    | 7289        | Wallsend     | Thomas Street at the intersection with Metcalfe Street, Wallsend                | West      | Flash not discharging  | Flash bulb replaced, tested OK.                      | 23/05/2016        |              |
| 20/05/2016    | 7289        | Wallsend     | Thomas Street at the intersection with Metcalfe Street, Wallsend                | West      | Unable to connect to camera                                      | Camera replaced. Site certified.                     | 25/05/2016        | <b>✓</b>     |
|               |             |              |   |           |  |  | Site Eve          | ents: 3      |
| 17/03/2016    | 7291        | Spring Hill  | Springhill Road (Northbound) at the intersection with Masters Road, Spring Hill | North     | Video camera   | Camera restarted, tested OK.                         | 18/03/2016        |              |
|               |             |              |   |           |  |  | Site Ev           | ents: 1      |

| the infersection with Masters Road, Spring Hill Hill Hill Spring Hill Hill Hill Spring Hill Hill Hill Spring Hill Hill Spring Hill Hill Hill Spring Hill Hill Hill Hill Hill Hill Spring Hill Hill Hill Hill Hill Hill Hill Hil  | Site<br>d Dow  | Date<br>Rectified | Restoration<br>Comments            | Sub Category                                | Direction | Location                            | Suburb       | Site<br>No. | Event<br>Date |
|--|----------------|-------------------|------------------------------------|---|-----------|-------------------------------------|--------------|-------------|---------------|
| the infersection with Masters Road. Spring Hill Hill Hill Spring Hill Hill Spring Hill Hill Hill Spring Hill Hill Hill Hill Spring Hill Hill Hill Spring Hill Hill Hill Hill Hill Hill Hill Spring Hill Hill Hill Hill Hill Hill Hill Hil   | 2015           | 28/05/2015        | ,                                  | Video file                                  | South     | the intersection with Masters Road, | Spring Hill  | 7292        | 21/05/2015    |
| the Intersection with Masters Road.    23/11/2015   7293   Burwood   Railway Parade at the Intersection with Burwood Road, Burwood Road at the intersection with Park Street at the intersection with Park Street at the intersection with Park Street Sydney    24/03/2015   7295   Sydney   Elizabeth Street at the intersection with Park Street, Sydney   Sydney   Elizabeth Street at the intersection with Park Street, Sydney   West   Hard drive disk space (HDD) low   Obsolete files removed.   9/09/2016   9/09/2016   7297   Lane Cove   Epping Road at the intersection with Centennial Avenue, Lane Cove   West   Unable to connect to camera   Camera power cycled, tested OK.   1/12/2016   7297   Lane Cove   Epping Road at the intersection with Centennial Avenue, Lane Cove   West   Unable to connect to camera   Camera restarted, tested OK.   6/05/2016   7297   Lane Cove   Epping Road at the intersection with Centennial Avenue, Lane Cove   West   Unable to connect to camera   Camera restarted, tested OK.   6/05/2016   7297   Lane Cove   Epping Road at the intersection with Centennial Avenue, Lane Cove   Epping Road at the Intersection with Centennial Avenue, Lane Cove   West   Unable to connect to camera   Camera restarted, tested OK.   6/05/2016   7297   Lane Cove   Epping Road at the Intersection with Centennial Avenue, Lane Cove   West   Unable to connect to camera   Camera restarted, tested OK.   6/05/2016   7297   7297   7297   7297   7297   7297   7297   7297    | 2015           | 23/12/2015        | Power supply replaced.             | Not generating incidents                    | South     | the intersection with Masters Road, | Spring Hill  | 7292        | 2/12/2015     |
| 23/11/2015 7293 Burwood Railway Parade at the intersection with Burwood Road, Road, Road, Road, Road, Road, Road, Road, Road, Ro | 2016           | 10/06/2016        | Loop settings modified, tested OK. | Image review required                       | South     | the intersection with Masters Road, | Spring Hill  | 7292        | 8/06/2016     |
| with Burwood Road, Burwood  Rookwood Road at the intersection with Brunker Road, Yagoona  Rookwood Road at the intersection with Brunker Road, Yagoona  Rookwood Road at the intersection with Brunker Road, Yagoona  South Flash not discharging Flash circuit breaker reset, tested 3/03/201  OK.  Sit 24/03/2015 7295 Sydney Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Crown Street, Darlinghurst  West Hard drive disk space (HDD) low  Obsolete files removed.  9/09/201  Str.  1/12/2015 7297 Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove  West Unable to connect to camera  Camera power cycled, tested OK.  6/05/2016  | ite Events:    | Site Ev           |                                    |   |           |                                     |              |             |               |
| Rookwood Road at the intersection with Brunker Road, Yagoona   Rookwood Road at the intersection with Brunker Road, Yagoona   South   Flash not discharging   Flash circuit breaker reset, tested   3/03/2016   OK.  | 2015           | 24/11/2015        |                                    | System event log notification               | West      |                                     | Burwood      | 7293        | 23/11/2015    |
| with Brunker Road, Yagoona  OK.  Sit  24/03/2015 7295 Sydney Elizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Park Street, Sydney  Blizabeth Street at the intersection with Crown Street, Darlinghurst  Blizabeth Street at the intersection with Crown Street, Darlinghurst  West Hard drive disk space (HDD) low  Obsolete files removed.  9/09/2015  Sit  1/12/2015 7297 Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove  West Unable to connect to camera  Camera power cycled, tested OK.  6/05/2016  Camera restarted, tested OK.  6/05/2016  | ite Events:    | Site Ev           |                                    |   |           |                                     |              |             |               |
| 24/03/2015 7295 Sydney Elizabeth Street at the intersection with Park Street, Sydney  Sydney Elizabeth Street at the intersection with Park Street, Sydney  Sydney Elizabeth Street at the intersection with Park Street, Sydney  Unable to enable/ disable camera operations  EC rebooted, tested OK.  1/07/2015  7296 Darlinghurst William Street at the intersection with Crown Street, Darlinghurst  Sit  1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera  Unable to connect to camera  Camera power cycled, tested OK.  1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera  Camera restarted, tested OK.  6/05/2016   | )16            | 3/03/2016         |                                    | Flash not discharging                       | South     |                                     | Yagoona      | 7294        | 1/03/2016     |
| with Park Street, Sydney  Elizabeth Street at the intersection with Park Street, Sydney  Figure 1/09/2015 7296 Darlinghurst  William Street at the intersection with Crown Street, Darlinghurst  West  Hard drive disk space (HDD) low  Obsolete files removed.  Sit  1/12/2015 7297 Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove  West  Unable to connect to camera  Camera power cycled, tested OK.  1/12/2016 7297 Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove  West  Unable to connect to camera  Camera restarted, tested OK.  6/05/2016   | ite Events:    | Site Ev           |                                    |   |           |                                     |              |             |               |
| with Park Street, Sydney  Sit  7/09/2015 7296 Darlinghurst William Street at the intersection with Crown Street, Darlinghurst West Hard drive disk space (HDD) low Obsolete files removed. 9/09/2015  Sit  1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera Camera power cycled, tested OK. 1/12/2015  7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera Camera restarted, tested OK. 6/05/2016  7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera Camera restarted, tested OK. 6/05/2016   | 2015 <b>✓</b>  | 31/03/2015        |                                    | Not creating images                         | North     |                                     | Sydney       | 7295        | 24/03/2015    |
| 7/09/2015 7296 Darlinghurst William Street at the intersection with Crown Street, Darlinghurst West Hard drive disk space (HDD) low Obsolete files removed.  Sit 1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove Unable to connect to camera Camera power cycled, tested OK. 1/12/2015 1/12/2016 7/10/2016 7/10/2017 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove Unable to connect to camera Camera restarted, tested OK. 6/05/2016 1/10/2019 1 | )16            | 1/07/2016         | EC rebooted, tested OK.            | Unable to enable/ disable camera operations | North     |                                     | Sydney       | 7295        | 30/06/2016    |
| with Crown Street, Darlinghurst  Sit  1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove  Epping Road at the intersection West Unable to connect to camera Camera power cycled, tested OK. 1/12/2015  7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera Camera restarted, tested OK. 6/05/2016  7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove West Unable to connect to camera Camera restarted, tested OK. 6/05/2016   | ite Events: :  | Site Ev           |                                    |   |           |                                     |              |             |               |
| 1/12/2015 7297 Lane Cove Epping Road at the intersection with Centennial Avenue, Lane Cove  Epping Road at the intersection with Centennial Avenue, Lane Cove  Epping Road at the intersection West Unable to connect to camera  Camera power cycled, tested OK. 1/12/2019  Camera restarted, tested OK. 6/05/2019  Camera restarted, tested OK. 6/05/2019   | )15            | 9/09/2015         | Obsolete files removed.            | Hard drive disk space (HDD) low             | West      |                                     | Darlinghurst | 7296        | 7/09/2015     |
| with Centennial Avenue, Lane Cove  5/05/2016 7297 Lane Cove Epping Road at the intersection West Unable to connect to camera Camera restarted, tested OK. 6/05/201 with Centennial Avenue, Lane Cove   | ite Events:    | Site Ev           |                                    |   |           |                                     |              |             |               |
| with Centennial Avenue, Lane Cove  | )15 <b>~</b>   | 1/12/2015         | Camera power cycled, tested OK.    | Unable to connect to camera                 | West      | 11 0                                | Lane Cove    | 7297        | 1/12/2015     |
|  | )16            | 6/05/2016         | Camera restarted, tested OK.       | Unable to connect to camera                 | West      | 11 0                                | Lane Cove    | 7297        | 5/05/2016     |
| 29/06/2016 7297 Lane Cove Epping Road at the intersection West Images dark - night System operations verified. 30/06/20 with Centennial Avenue, Lane Cove  | 2016           | 30/06/2016        | System operations verified.        | Images dark - night                         | West      |                                     | Lane Cove    | 7297        | 29/06/2016    |
| Sit  | Site Events: 3 |                   |                                    |   |           |                                     |              |             |               |
| 1/02/2016 7298 Ermington Victoria Road at the intersection East Not generating incidents System power cycled, tested OK. 2/02/2016 with Spurway Street, Ermington  | )16 <b>~</b>   | 2/02/2016         | System power cycled, tested OK.    | Not generating incidents                    | East      |                                     | Ermington    | 7298        | 1/02/2016     |

| Event<br>Date | Site<br>No. | Suburb          | Location  | Direction | Sub Category   | Restoration<br>Comments   | Date<br>Rectified | Site<br>Down |
|---------------|-------------|-----------------|---|-----------|--|---|-------------------|--------------|
| 18/02/2015    | 7299        | Merrylands West | Merrylands Road at the intersection with Sherwood Road, Merrylands West       | West      | Excessive images   | Camera settings adjusted, tested OK.                                  | 11/05/2015        |              |
|               |             |                 |   |           |  |   | Site Ev           | ents: 1      |
| 2/04/2015     | 7300        | Auburn          | Rawson Street at the intersection with Station Road, Auburn                   | West      | Images out of focus  | Focus adjusted, tested OK.  | 30/04/2015        | •            |
| 10/06/2015    | 7300        | Auburn          | Rawson Street at the intersection with Station Road, Auburn                   | West      | Images out of focus  | Focus adjusted, tested OK.  | 10/06/2015        | <b>✓</b>     |
| 30/06/2016    | 7300        | Auburn          | Rawson Street at the intersection with Station Road, Auburn                   | West      | Images dark - night  | Camera settings adjusted, tested OK.                                  | 1/07/2016         |              |
|               |             |                 |   |           |  |   | Site Ev           | ents: 3      |
| 17/09/2015    | 7301        | Eastwood (Z)    | Rutledge Street at the intersection with Shaftsbury Road, Eastwood (Z)        | West      | Camera operating as a School Zone (SZ) outside scheduled times | Camera restarted, tested OK.  | 18/09/2015        |              |
| 13/10/2015    | 7301        | Eastwood (Z)    | Rutledge Street at the intersection with Shaftsbury Road, Eastwood (Z)        |           | Image review required  | Camera system settings reconfigured, tested OK.                       | 14/10/2015        |              |
|               |             |                 |   |           |  |   | Site Ev           | ents: 2      |
| 9/03/2015     | 7302        | Darlinghurst    | Oxford Street (Westbound) at the intersection with Crown Street, Darlinghurst | West      | Not generating incidents                                       | Enforcement Controller (EC) connections reterminated. Site certified. | 24/03/2015        |              |
| 9/06/2015     | 7302        | Darlinghurst    | Oxford Street (Westbound) at the intersection with Crown Street, Darlinghurst | West      | Images out of focus  | Focus adjusted, tested OK.  | 15/06/2015        | •            |
| 7/03/2016     | 7302        | Darlinghurst    | Oxford Street (Westbound) at the intersection with Crown Street, Darlinghurst | West      | Distorted images   | Camera drivers reinstalled, tested OK.                                | 9/03/2016         | •            |
|               |             |                 |   |           |  |   | Site Ev           | ents: 3      |
| 1/02/2016     | 7303        | Epping          | Carlingford Road at the intersection with Rawson Street, Epping               | West      | Not generating incidents                                       | System power cycled, tested OK.                                       | 2/02/2016         | •            |
| 9/02/2016     | 7303        | Epping          | Carlingford Road at the intersection with Rawson Street, Epping               | West      | Not generating incidents                                       | System power cycled, tested OK.                                       | 10/02/2016        | <b>✓</b>     |
| 11/03/2016    | 7303        | Epping          | Carlingford Road at the intersection with Rawson Street, Epping               | West      | Not generating incidents                                       | System power cycled, tested OK.                                       | 11/03/2016        | •            |
|               |             |                 |   |           |  |   | CH- E             |              |

| Event<br>Date | Site<br>No. | Suburb       | Location   | Direction | Sub Category                    | Restoration<br>Comments                         | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------|--|-----------|---------------------------------|---|-------------------|--------------|
| 20/05/2015    | 7305        | Neutral Bay  | Falcon Street at the intersection with Merlin Street, Neutral Bay                  | West      | Not creating images             | Camera system settings reconfigured, tested OK. | 21/05/2015        | <b>✓</b>     |
| 16/06/2015    | 7305        | Neutral Bay  | Falcon Street at the intersection with Merlin Street, Neutral Bay                  | West      | Not generating incidents        | Camera settings adjusted, tested OK.            | 17/06/2015        | <b>✓</b>     |
| 5/11/2015     | 7305        | Neutral Bay  | Falcon Street at the intersection with Merlin Street, Neutral Bay                  | West      | Hard drive disk space (HDD) low | Obsolete files removed.                         | 6/11/2015         | <b>✓</b>     |
| 13/04/2016    | 7305        | Neutral Bay  | Falcon Street at the intersection with Merlin Street, Neutral Bay                  | West      | Not generating incidents        | Camera settings adjusted, tested OK.            | 15/04/2016        |              |
|               |             |              |  |           |                                 |   | Site Ev           | ents: 4      |
| 7/07/2015     | 7307        | Waitara (Z)  | Pacific Highway at the intersection with Romsey Street, Waitara (Z)                | East      | Hard drive disk space (HDD) low | Obsolete files removed.                         | 8/07/2015         |              |
|               |             |              |  |           |                                 |   | Site Eve          | ents: 1      |
| 21/05/2015    | 7308        | Maroubra     | Anzac Parade at the intersection with Boyce Road, Maroubra                         | South     | Camera requires realignment     | Camera realigned, tested OK.                    | 27/05/2015        |              |
|               |             |              |  |           |                                 |   | Site Eve          | ents: 1      |
| 22/09/2015    | 7309        | Castle Hill  | Pennant Street at the intersection with Castle Street, Castle Hill                 | North     | Flash continuously discharging  | Flash trigger cable rewired.                    | 14/10/2015        |              |
|               |             |              |  |           |                                 |   | Site Eve          | ents: 1      |
| 9/02/2016     | 7312        | Dean Park    | Richmond Road at the intersection with M7 Motorway On-Ramp (Southbound), Dean Park | East      | Not generating incidents        | System power cycled, tested OK.                 | 9/02/2016         |              |
|               |             |              |  |           |                                 |   | Site Ev           | ents: 1      |
| 31/05/2016    | 7313        | Blakehurst   | King Georges Road at the intersection with Terry Street, Blakehurst                | South     | Not generating incidents        | System operations verified.                     | 31/05/2016        |              |
|               |             |              |  |           |                                 |   | Site Ev           | ents: 1      |
| 29/04/2016    | 7314        | Fairfield    | Sackville Street at the intersection with Hamilton Road, Fairfield                 | South     | Images dark - night             | Flash circuit breaker reset, tested OK.         | 5/05/2016         |              |
|               |             |              |  |           |                                 |   | Site Ev           | ents: 1      |
| 15/04/2016    | 7318        | Darlinghurst | Oxford Street (Eastbound) at the intersection with Crown Street, Darlinghurst      | East      | Horizontal bands across images  | Camera system restarted, tested OK.             | 15/04/2016        |              |
|               |             |              | <u> </u>   |           |                                 |   | Sito Ev           | onto: 1      |

| Event<br>Date | Site<br>No. | Suburb             | Location  | Direction | Sub Category             | Restoration<br>Comments                                    | Date<br>Rectified | Site<br>Down |
|---------------|-------------|--------------------|---|-----------|--------------------------|--|-------------------|--------------|
| 15/02/2016    | 7319        | Eastern Creek      | Great Western Highway at the intersection with Rooty Hill Road South, Eastern Creek | East      | Images black             | Paint removed from camera housing lens.                    | 22/02/2016        | ✓            |
|               |             |                    |   |           |                          |  | Site Ev           | ents: 1      |
| 3/03/2016     | 7320        | Kingsgrove         | Stoney Creek Road at the intersection with Patrick Street, Kingsgrove               | East      | Flash not discharging    | Flash bulb replaced, tested OK.                            | 8/03/2016         |              |
| 16/06/2016    | 7320        | Kingsgrove         | Stoney Creek Road at the intersection with Patrick Street, Kingsgrove               | East      | Flash not discharging    | Flash replaced.  | 23/06/2016        |              |
|               |             |                    |   |           |                          |  | Site Eve          | ents: 2      |
| 13/04/2016    | 7321        | Yagoona            | Rookwood Road at the intersection with Muir Road, Yagoona                           | North     | Not generating incidents | System operations verified, vendor advises sensor related. | 15/04/2016        | <b>✓</b>     |
|               |             |                    |   |           |                          |  | Site Ev           | ents: 1      |
| 26/02/2016    | 7322        | Greenacre          | Roberts Road at the intersection with Juno Parade, Greenacre                        | North     | Not creating images      | Camera system power cycled, tested OK.                     | 26/02/2016        | •            |
|               |             |                    |   |           |                          |  | Site Ev           | ents: 1      |
| 9/12/2015     | 7324        | Canley Heights (Z) | Cumberland Highway at the intersection with Canley Vale Road, Canley Heights (Z)    | North     | Not creating images      | Camera connections reterminated, tested OK.                | 14/12/2015        | •            |
| 11/03/2016    | 7324        | Canley Heights (Z) | Cumberland Highway at the intersection with Canley Vale Road, Canley Heights (Z)    | North     | Not generating incidents | System power cycled, tested OK.                            | 11/03/2016        | ✓            |
| 26/05/2016    | 7324        | Canley Heights (Z) | Cumberland Highway at the intersection with Canley Vale Road, Canley Heights (Z)    | North     | Time Server              | Power restored to time server, tested OK.                  | 26/05/2016        |              |
|               |             |                    |   |           |                          |  | Site Ev           | ents: 3      |
| 14/08/2015    | 7327        | Blacktown          | Third Avenue at the intersection with Richmond Road, Blacktown                      | South     | Not creating images      | System operation verified.                                 | 20/08/2015        | •            |
| 22/01/2016    | 7327        | Blacktown          | Third Avenue at the intersection with Richmond Road, Blacktown                      | South     | Image review required    | Camera system settings reconfigured, tested OK.            | 29/01/2016        |              |
|               |             |                    |   |           |                          |  | Site Ev           | ents: 2      |

**Total RLSC Maintenance Events: 252** 

**Grand Total Maintenance Events: 502** 

In accordance with section 75(1) of the GIPA Act, a new record containing information from the Compliance Operations Branch has been created. This new record is below:

In NSW there are currently 178 Red Light Speed Cameras at 160 intersections, 133 Fixed Digital Speed Cameras and 45 Mobile Speed Camera Vehicles.

This response is provided in accordance with the date range as per the GIPA request.

## Response to "All calibration certificates that identified a incorrectly calibrated speed cameras":

No calibrations certificates were generated for any device not operating correctly. In excess of 85,000 tests were carried out across the network of enforcement cameras\* and certificates produced on each occasion attesting to the devices operating correctly, in line with manufacturer's specification and relevant legislation, at the time of certification.

\*This includes Red Light Speed Cameras, Fixed Digital Speed Cameras, and Mobile Speed Cameras.

## Response to "Any report on issues of accuracy and reliability of NSW speed cameras":

Maintenance issues affecting accuracy occur rarely and other reliability issues occur occasionally between certification tests.

A total of 3 speed camera related maintenance events have been attributed to accuracy issues as per the attached report (page 1 of information released). Any affected incidents were culled or penalty notices withdrawn if they had been issued.

A total of 502 speed camera related maintenance events were generated as per the attached report (pages 2-41 of the information released). Despite some of these being attributed to reliability issues, the systems are inherently reliable given the environmental conditions they operate within, and uptime is typically >95%. In addition to the attached report, Roads & Maritime is advised that 6 radar units were replaced within the Mobile Speed Camera program.

Any camera maintenance issue detected that has any possibility of causing an invalid infringement being sent to a member of the public results in a camera being taken offline until the maintenance issue is identified, rectified and re-certified where necessary. The policy of Roads & Maritime is to ensure that any incidents that could be negatively affected by accuracy or reliability issues do not result in a penalty notice being issued, or withdrawn where appropriate.